

Appendix E

Bankfield Drive - 07/02/25

Chainage 0m



Comments – Manhole Ironwork slightly sunk.
Focus Point.

Chainage 0m



Comments – give way markings severley warn.

Chainage 0m



Comments – line marking severely worn. Localised area where surface course starting to break up.
Focus point.

Chainage 0m



Comments – radius kerbs uneven.

Chainage 5m



Comments – road surface sunk causing surface course to crack. Kerb line uneven adjacent to sunken gully. Trench reinstatement along right hand side of carriageway generally ok but joint not sealed leading to potential premature degradation. Centre line warn.

Chainage 10m



Comments – Centre line warn

Chainage 20m



Comments – Centre line warn. Surface course up against left hand drainage channel degraded.

Chainage 25m



Comments – Centre line warn. Patchrepair around gully appears to be ok. Carrigeway / kerb settlement at chainage 29m

Chainage 30m



Comments – Kerb line and carriage way affected due to settlement. Iron work uneven due to similar problems with structural integrity of subbase. Requires attention. Focus point for monitoring.

Chainage 30m



Comments – some evidence of surface course cracking.

Chainage 40m



Comments – Patch repairs with no joint seal. Surface course cracks starting to develop.

Chainage 50m



Comments – surface course tensile cracks starting to develop along left-hand side of carriageway due to settlement.

Chainage 60m



Comment – Patch repair along right hand side of carriageway, no joint seal.

Chainage 65m



Comments - Drop kerb on right hand side of carriageway uneven, patch repair reinstatement continues. No joint seal.

Chainage 70m



Comments – as previous.

Chainage 80m



Comments – patch repair without sealed joint along right handside of carriageway.

Chainage 90m



Comments – patch repair continues along right hand side of carriageway. Sunken road gully and drainage channel on left

Chainage 94m



Comments – sunken gully in more detail plus some evidence of tensile cracks in surface course.

Chainage 100m



Comments – patch repiारे along right hand side of carriageway, no joint seal.

Chainage 110m



Comments – surface couse tensile cracks along left hand side of carriageway due to premature settlement. Evidence of transverse crack across carriageway. Patch repair along right hand side with no joint seal.

Chainage 165m



Comments – Patch repair along right hand side of carriageway, no joint seal. Road gully and drainage channel appears to have sunk.

Chainage 120m



Comments – Patch repair on right hand side, no joint seal.

Chainage 125m



Comments – none

Chinage 130m



Comments - none