ARBORICULTURAL METHOD STATEMENT
to BS 5837:2012
at
New Hey Road
Salendine Nook
Huddersfield
West Yorkshire
HD3 4GS

Client:
FDA Landscape Ltd

Client Address:
Westleigh Hall
Wakefield Road
Denby Dale
Huddersfield
West Yorkshire
HD8 8QZ

Client Telephone:
01484 861611

JCA Ref:
16383-B/AJB



JCA Limited
Arboricultural & Ecological Consultants

Contents

1. Introduction....3

2. Tree Works Prior, During and Post Construction....4

3. The Protective Barrier Prior, During and Post Construction....6

4. Construction Phase....8

4.1 Demolition Works....8

4.2 Ground Level Changes....8

4.3 Construction of Hard Surfaces....8

4.4 Construction of New Building....8

4.5 Excavations and Services....8

4.6 Construction of Retaining Wall....8

5. Post Construction Phase....9

5.1 Completion Meeting....9

5.2 Post Construction Landscaping....9

6. Timescale of Works....10

7. Relevant Contact Details....10

Appendix 1: Tree Works Schedule....12

Appendix 2: Protective Barrier....13

Appendix 3: Tree Protection Plan....15

© JCA Limited 2021

1. Introduction

1.1 Purpose of the Method Statement

1.1.1 This Arboricultural Method Statement has been prepared to ensure good practice in the protection of retained trees during the development at **New Hey Road**, **Salendine Nook**, **Huddersfield**.

1.2 Terms of Reference

1.2.1 JCA Limited is instructed by **FDA Landscape** to prepare an Arboricultural Method Statement for the proposed development, based on our arboricultural report dated 2nd October 2020 (JCA Ref: **16383/AJB**). The arboricultural survey and report conforms to the most recent specifications outlined in BS 5837: 2012 *Trees in relation to design, demolition and construction - Recommendations*.

1.2.2 The proposed development will consist of the construction of a Lidl supermarket.

1.2.3 The following drawings have been provided and these are the basis of the Arboricultural Method Statement and the Tree Protection Plan at **Appendix 3**:

- Topographical Survey (Drawing No. **TOPO New Hey Road Huddersfield 01-09-14**).
- Development Layout (Drawing No. **1814 P417B Proposed Site Plan (1,100 Sales Area)**).

1.3.1 This Arboricultural Method Statement should be included as part of the specification and schedule of works issued to the building contractor and can form part of the contract.

1.3.2 This Arboricultural Method Statement should be available on site for inspection by the local authority, contractors and other relevant persons.

© JCA Limited 2021

2. Tree Works Prior, During and Post Construction

2.1 Tree Works Prior to Construction

2.1.1 Prior to any construction activity, the first operation on site will be the undertaking of the necessary arboricultural works, as described at **Appendix 1**.

2.1.2 The tree works include:

- The removal of **G1**, for arboricultural reasons.
- The removal of **T9, G10, G12** and **G18**, to facilitate the proposed development.
- The root pruning of **T5**.

2.1.3 The root pruning required for **T5** in order to facilitate a proposed car park, and the location of the required pruning can be seen in blue shade on the plan at **Appendix 3**. This operation will be undertaken prior to the erection of the protective fencing and will be supervised throughout by the appointed arboriculturalist.

2.1.4 For this method, the closest point of the proposed car park in relation to the **T5** will be marked on-site by an appointed engineer or another qualified person, using an appropriate method (e.g. temporary, biodegradable spray paint or pegs and lines). A hand-dug trench will then be excavated along this line, to a minimum depth of 600mm and to a width of approximately 300mm. Any roots exposed during this operation will be cleanly severed using appropriate hand tools (e.g. sanitised hand saws or bypass secateurs).

2.2 Tree Works During Construction

2.2.1 In this case, no above ground tree works are envisaged to be required during the construction phase.

2.2.2 Damage to trees during the construction phase should be entirely prevented by the installation of the temporary protective fencing in order to create a Construction Exclusion Zone (CEZ). All persons on site must be aware of limitations that apply within the CEZ (please refer to **Section 3.1.3**).

2.2.3 If any trees on site are damaged, this must be immediately reported to JCA to agree on appropriate remedial action. Contact numbers for all parties can be found at **Section 7**.

© JCA Limited 2021

2.3 Tree Works Post Construction

2.3.1 When the construction phase is complete and when the temporary protective barrier has been removed, some minor remedial works may be required. This may be for aesthetic purposes, to give clearance for new paths or to provide ground clearance for landscaping schemes.

2.3.2 Any post construction remedial works must be applied for via a tree work application submitted to the Local Planning Authority.

2.3.3 No post construction remedial works are to be carried out on the trees until permission has been granted by the Local Planning Authority.

2.4 Recommendations for Tree Works

2.4.1 All work must be undertaken to BS 3998: 2010 - *Recommendations for tree work* and carried out by qualified, experienced and, ideally, Arboricultural Association approved contractors who must be adequately insured.

2.4.2 Any defects seen by a contractor or the client that were not apparent to the consultant must be brought to the attention of JCA immediately.

2.4.3 No liability can be accepted by JCA in respect of the trees unless the recommendations of this Method Statement are carried out under our supervision.

© JCA Limited 2021

3. The Protective Barrier Prior, During and Post Construction

3.1 Protective Barrier Prior to Construction

3.1.1 The installation of the temporary protective fencing will be the very first job to be undertaken on site following the completion of the tree works (**Section 2.1**).

3.1.2 The protective fencing must be constructed in accordance with BS 5837: 2012 *Trees in relation to design, demolition and construction - Recommendations* and will be located as shown on the Tree Protection Plan at **Appendix 3**. Where possible, the protective barrier will enclose the entire Root Protection Area (RPA) of the trees to make a Construction Exclusion Zone (CEZ); **this area is to be considered a restricted area; no pedestrians, vehicles, equipment or machinery are allowed within the CEZ and the storage of materials is not permitted, unless specified within this Method Statement**.

3.1.3 The protective fencing will be installed in accordance with BS 5837: 2012 and will comprise of a vertical and horizontal scaffold framework, well braced to resist impacts. The vertical tubes should be spaced at a maximum interval of 3m and driven securely into the ground, taking care to avoid underground services and structural roots. Finally, weld mesh panels are to be securely fixed on the scaffold framework. Please refer to **Appendix 2** for protective fencing details.

3.1.4 Once the fencing is installed, waterproof signs with the sentence '*Protected tree zone, no storage or operations within this are*a' are to be placed at 3m intervals to ensure that all personnel are aware of the restrictions that apply to the cordoned off area. A prepared sign is available at **Appendix 2**.

3.2 Ground Protection

3.2.1 Ground protection is not required for retained trees for this project.

3.3 Checking the Protective Fencing Prior to Construction

3.3.1 Once installed, the appointed arboriculturalist will be invited on site to inspect the protective fencing, ensuring that it is located in the correct position and that it has been constructed in accordance with this Method Statement. No other work, including soil stripping, excavation, or the bringing onto site of materials or machinery, shall commence until the barrier is installed and confirmed to be acceptable by the appointed arboriculturalist.

© JCA Limited 2021

3.3.2 It is important that the protective fencing be checked by the LPA or an arboricultural consultant prior to any construction works being carried out on site. **If at any time during construction the protective fencing is not correctly installed, or if it does not comply with BS 5837: 2012, this could result in damage being caused to trees and consequently, a stop notice may be served by the LPA.**

3.4 Protective Fencing During Construction

3.4.1 No operations shall take place which require the removal of part of the protective fencing without prior agreement with the Local Planning Authority or JCA.

3.4.2 The protective fencing must be inspected for faults or damage by the site manager or other responsible named person on a regular basis and a written record kept. Any faults or defects must be repaired or replaced as soon as is reasonably practicable. Details of the site manager and relevant contact details can be found at **Section 7**.

3.5 Removal of the Protective Fencing

3.5.1 When the development phase is complete and the main site machinery has been removed, the Local Planning Authority should be invited to inspect the site to give approval for the removal of the protective fencing.

3.5.2 When this approval has been given the protective fencing may be dismantled and removed from site.

3.5.3 It should be noted the same restrictions apply to all RPAs as the CEZ (please refer to **Section 3.1.2**).

© JCA Limited 2021

4. Construction Phase

4.1 Demolition Works

4.1.1 No demolition works are required adjacent to retained trees.

4.2 Ground Level Changes

4.2.1 No ground level changes are required within the RPA of any tree to be retained on this site. As such no mitigation actions are considered necessary.

4.3 Construction of Hard Surfaces

4.3.1 With the exception of the car park within the rooting zone of **T5** which requires root pruning prior to the onset of the construction phase, no other hard surfaces are proposed within the RPA of retained trees. As such, no specialist mitigation actions are required.

4.4 Construction of New Building

4.4.1 The proposed supermarket is located at a sufficient distance from retained trees that no specialist foundation methods are required for arboricultural purposes.

4.5 Excavations and Services

4.5.1 The routing of proposed utilities is situated outside the RPAs of retained trees. As such, no mitigation actions are considered necessary to mitigate potential damage to tree roots.

4.6 Construction of Retaining Wall

4.6.1 A retaining wall is to be erected adjacent to the rooting zones of **G13**. In order to ensure that tree roots are not damaged and to avoid potential land slip, the rear of the wall is to be sheet piled.

© JCA Limited 2021

5. Post Construction Phase

5.1 Completion Meeting

5.1.1 Upon completion of the works as specified in **Section 4**, a JCA consultant will invite the Local Planning Authority representative to meet with them on site to agree on any remedial works which may be required (if any).

5.1.2 Any necessary remedial tree works will be confirmed in writing and must be carried out in accordance with BS 3998: 2010 - *Recommendations for tree work*.

5.2 Post Construction Landscaping

5.2.1 Following completion of the main construction phase, the protective fencing and may be removed and the landscaping phase can commence.

5.2.2 The retained trees on site may be subject to some form of landscaping or seeding beneath their canopies after the development phase. At this stage the protective fencing will have been removed.

5.2.3 Landscaping works must be carried out in such a way as to avoid ground level changes or deep digging within RPAs. Tractor mounted rotovation or other mechanised cultivation methods must not be used within the RPAs of retained trees.

5.2.4 Heavy machinery is not permitted in the vicinity of retained trees, unless otherwise stated in this method statement.

5.2.5 Herbicides should be appropriate for the purpose and should not be used in such a way as to damage any retained trees or vegetation.

5.2.6 If in doubt, regarding the impact of proposed landscape operations, please contact the appointed arboriculturalist.

© JCA Limited 2021

6. Timescale of Works

6.1.1 The timescale for arboricultural requirements are summarised below:

Timescale	Action	✓	Initial
Stage 1	All requirements listed in the planning consent are approved by the Local Authority planning office.		
Stage 2	Undertake the tree works (as detailed at **Appendix 1)**.		
Stage 3	Install the temporary protective fencing around the trees (as detailed at **Appendix 2** and as shown on the Tree Protection Plan at **Appendix 3**).		
Stage 4	Have the Local Planning Authority or Arboricultural Consultant inspect the fencing measures prior to any on site construction. Once inspected, the protective fencing must not to be moved or breached.		
Stage 5	Undertake the construction phase.		
Stage 6	Completion meeting (**Section 5**)		
Stage 7	Following the completion of the construction phase and when all site traffic and machinery has left, the protective fencing can be removed.		
Stage 8	Post construction remedial tree works to be undertaken (if required).		
Stage 9	Undertake the landscaping scheme in line with **Section 5**.		

7. Relevant Contact Details

Contact Name	Organisation/Detail	Contact Number
Andrew Bussey Arboricultural Consultant	JCA Limited	01422 376335
Nick Goddard Tree Officer	Kirklees Metropolitan Borough Council	01484 221589
TBC Site Manager	TBC	TBC

© JCA Limited 2021

Appendices


Tree Ref.	Age Common Name *Botanical Name*	Height (m)	Crown Height (m)	Height (m) and Direction of the Lowest Branch	Diameter (cm)	Crown Spread N W E S	Observations	Recommendations	Physiological Condition	Structural Condition	Amenity Value	NHBC Water Demand	Life Expectancy (yrs)	Retention Category
G 1	Early-mature Mixed species *Details in observations*	To 6	0+	0+ n/a	To 20	See plan	Coppiced Elm and Elder stumps with decay noted.	Remove.	POOR	POOR	LOW	LOW TO HIGH	≥0	U
T 2	Early-mature Sycamore *Acer pseudoplatanus*	13	3.5	0.5 E	42	4.5 4.5 6 4	An off-site specimen. In overall good condition with no major visible defects. Multiple pruning wounds due to crown lifting in lower crown, with small decay pockets forming. Epicormic growth noted at base.	No action required.	GOOD	GOOD	MOD	MOD	≥20	B 1
G 3	Semi-mature Group *Details in observations*	9	0	0 n/a	20	See plan	Group of off-site, self-set trees, suppressed by T2. In acceptable condition at this time but of little arboricultural or landscape value. Species include Common Ash, Elder and English Elm.	No action required.	FAIR	FAIR	LOW	HIGH	≥20	C 1
T 4	Early-mature Common Ash *Fraxinus excelsior*	14	3	4 SE	27	3 3 6 4.5	An off-site specimen in overall good condition with no major visible defects. Good future potential though could displace the adjacent wall in coming years. Slightly suppressed by T5.	No action required.	GOOD	GOOD	MOD	MOD	≥20	B 1
T 5	Early-mature Sycamore *Acer pseudoplatanus*	11	2.5	0 SW	33, 34	6 6 5.5 6	An off-site specimen, twin-stemmed from ground level with a fairly balanced crown. In overall good condition with no major visible defects. Epicormic growth at base, minor deadwood in crown.	Root prune the area shown in blue shade on the plan at **Appendix 3** under arboricultural supervision.	GOOD	GOOD	MOD	MOD	≥20	B 1
T 6	Semi-mature Common or Black Elder *Sambucus nigra*	4.5	2.5	1 n/a	10, 7, 8	4 3.5 4 0	A small, suppressed specimen of little arboricultural value. Located off-site.	No action required.	FAIR	FAIR	LOW	LOW	≥10	C 1
T 7	Early-mature Sycamore *Acer pseudoplatanus*	13	0	4 SE	35	4.5 4 6 5	An off-site specimen, single-stemmed and vertical with a balanced crown. No major visible defects. Dense epicormic growth at base. It appears to be in good condition with no major visible defects.	No action required.	GOOD	GOOD	MOD	MOD	≥20	B 1
T 8	Semi-mature Sycamore *Acer pseudoplatanus*	13	1.5	0 W	13, 20, 26	4 4 4 3.5	An off-site specimen. Multiple-stemmed from ground level with a fairly balanced crown. Some bark wounding due to fire damage to the northeast, as well as a broken branch. Snapped stem to the north adjacent to track. It is in acceptable condition at this time.	No action required.	FAIR	GOOD	LOW	MOD	≥20	C 1

Tree Ref.	Age Common Name *Botanical Name*	Height (m)	Crown Height (m)	Height (m) and Direction of the Lowest Branch	Diameter (cm)	Crown Spread N W E S	Observations	Recommendations	Physiological Condition	Structural Condition	Amenity Value	NHBC Water Demand	Life Expectancy (yrs)	Retention Category
T 9	Early-mature Swedish Whitebeam *Sorbus intermedia*	12	2	3 SE	23	4.5 4.5 4.5 4.5	Single-stemmed and vertical with a balanced crown. In overall good condition with no major visible defects.Occasional pruning wounds due to crown lifting, with stubs remaining. Wounding in lower crown due to fire damage or possibly squirrel damage.	Remove to facilitate the proposed development.	GOOD	GOOD	LOW	MOD	≥20	C 1
G 10	Early-mature Mixed species *Details in observations*	To 5	0+	0+ n/a	To 10	See plan	Self-seeded Sycamore, Common Ash and Elm of little significance.	Remove to facilitate the proposed development.	FAIR	FAIR	LOW	MOD TO HIGH	≥10	C 1
T 11	Early Mature Sycamore *Acer pseudoplatanus*	9	1	1 n/a	30#	1 3 2.5 3	Situated on adjacent land. Single-stemmed and vertical with an unbalanced crown. Decay to the stem.	Inform the trees owner of their duty of care to have the tree removed.	FAIR	POOR	LOW	MOD	≥0	U
G 12	Semi-mature Common Ash *Fraxinus excelsior*	9	2	2 n/a	15	4.5 4.5 4.5 4.5	Self-set stems of Ash along the dry stone wall. Currently of little arboricultural value, although in good condition at present.	Remove to facilitate the proposed development.	GOOD	GOOD	LOW	MOD	≥20	C 1
G 13	Mature Sycamore *Acer pseudoplatanus*	17	3	2 n/a	To 61	See plan (av. 7.5m spread)	Off-site, linear group of trees situated along the boundary and overhanging. 9 trees in total (8 Sycamore & 1 Elm). The Elm has minor bark wounds in the crown and has significant die-back. A prominent feature within the site. Western most specimen has bark wounding at base with the onset of decay but is in acceptable condition at this time. Ivy cover, epicormic growth and minor deadwood noted.	Inform the trees owner of their duty of care to have the Elm removed.	GOOD	GOOD	MOD	MOD	≥20	B 1
G 14	Semi-mature Group *Details in observations*	13	0	0 n/a	18	See plan	A large mass of vegetation, almost exclusively located off-site. Some small, dead Elm stems noted within (posing little risk at this time). Otherwise, trees within appear to be in acceptable condition at this time. Species include Common Ash, Hawthorn, English Elm and Sycamore.	No action required.	GOOD	GOOD	LOW	HIGH	≥20	C 1
G 15	Early-mature Common Ash *Fraxinus excelsior*	12	1.5	2.5 n/a	23	See plan (av. 6m spread)	Linear group of off-site trees, situated alongside the footpath and overhanging the boundary. Minor deadwood and some bark wounds where rubbing against wire fencing but no major visible defects.	No action required.	GOOD	GOOD	MOD	MOD	≥20	B 1
T 16	Semi-mature Common Hawthorn *Crataegus monogyna*	4	0	0.4 E	13, 12	2.5 2.5 2.5 2.5	A small, self-set specimen of little arboricultural value. In acceptable condition at this time.	No action required.	GOOD	GOOD	LOW	HIGH	≥10	C 1

Tree Ref.	Age Common Name *Botanical Name*	Height (m)	Crown Height (m)	Height (m) and Direction of the Lowest Branch	Diameter (cm)	Crown Spread N W E S	Observations	Recommendations	Physiological Condition	Structural Condition	Amenity Value	NHBC Water Demand	Life Expectancy (yrs)	Retention Category
H 17	Semi-mature Leyland Cypress *X Cupressocyparis leylandii*	4	0	0 n/a	12	See plan (2m wide)	Typical garden boundary hedgerow; well maintained and providing effective screening. No major visible defects.	No action required.	GOOD	GOOD	LOW	HIGH	≥20	C 1
G 18	Young Group *Details in observations*	6	0	0 n/a	8	See plan	Clusters of young, self-set vegetation of little arboricultual value. Species include Common Ash & Elder.	Remove to facilitate the proposed development.	FAIR	FAIR	LOW	MOD	≥10	C 1

Appendix 2: Protective Barrier

A2.1 The protective barrier will be installed in accordance with BS5837: 2012. The default specification of BS 5837: 2012 (pictured below for reference) recommends a vertical and horizontal, scaffold framework, well braced to resist impacts, with vertical tubes at no more than 3m intervals. These should be driven into the ground. Weld mesh panels should be affixed to this framework with scaffold clamps.

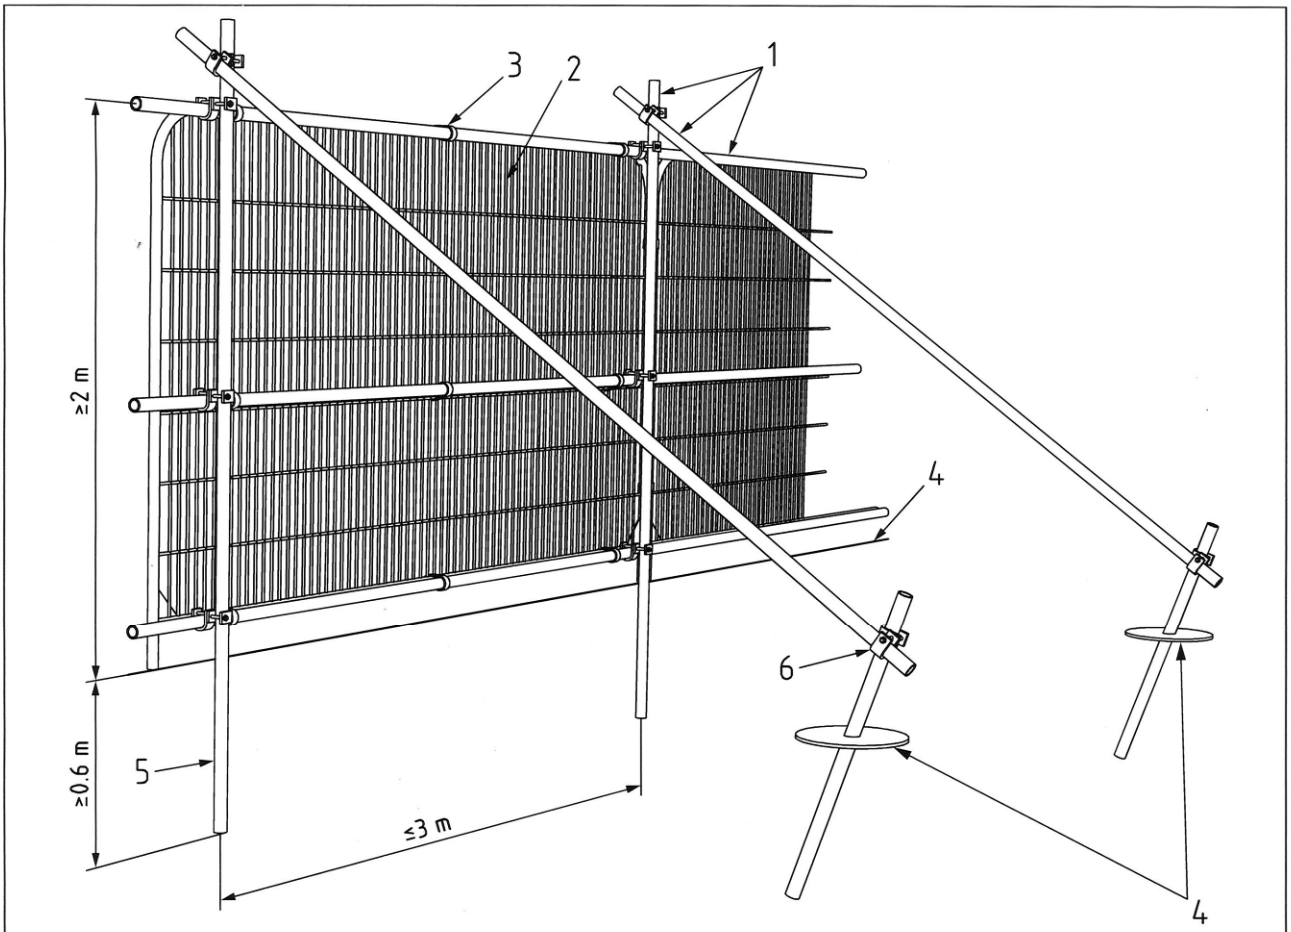

Key

1 Standard scaffold poles
2 Heavy gauge 2 m tall galvanized tube and welded mesh infill panels
3 Panels secured to uprights and cross-members with wire ties
4 Ground level
5 Uprights driven into the ground until secure (minimum depth 0.6 m)
6 Standard scaffold clamps

Protective Barrier to BS 5837: 2012. To be used where situated in open ground.

© JCA Limited 2021

TREE PROTECTION ZONE

KEEP OUT!

TREES ENCLOSED BY THIS FENCE ARE PROTECTED
BY STRICT PLANNING CONDITIONS

ANY DAMAGE CAUSED TO THESE TREES MAY
RESULT IN **CRIMINAL PROSECUTION**

RESTRICTED AREA:

- THE PROTECTIVE FENCE MUST NOT BE MOVED OR BREACHED
- NO PERSON, MACHINERY, VEHICLE OR PLANT IS PERMITTED WITHIN THE TREE PROTECTION ZONE
- NO MATERIALS SHALL BE STORED WITHIN THE TREE PROTECTION ZONE
- NO EXCAVATIONS ARE PERMITTED WITHIN THE TREE PROTECTION ZONE
- NO SPOIL IS TO BE DEPOSITED WITHIN THE TREE PROTECTION ZONE
- NO FIRES ARE TO BE LIT WITHIN THE TREE PROTECTION ZONE

REPORT TREE DAMAGE TO JCA LIMITED ON
01422 376 335

N


W E

S

NO WORKS ARE PROPOSED FOR THE EXISTING CULVERT UNDER THIS APPLICATION. THE CULVERT DIVERSION IS LOCATED OUTSIDE TREE ROOTING ZONES

THE REAR OF THE PROPOSED RETAINING WALL IS TO BE SHEET PILED IN ORDER TO AVOID ROOT DAMAGE.
THE RETAINING WALL IS TO BE CONSTRUCTED IN ORDER TO MAINTAIN THE EXISTING GROUND LEVELS WITHIN G13.

AREA TO BE ROOT PRUNED UNDER ABORICULTURAL SUPERVISION

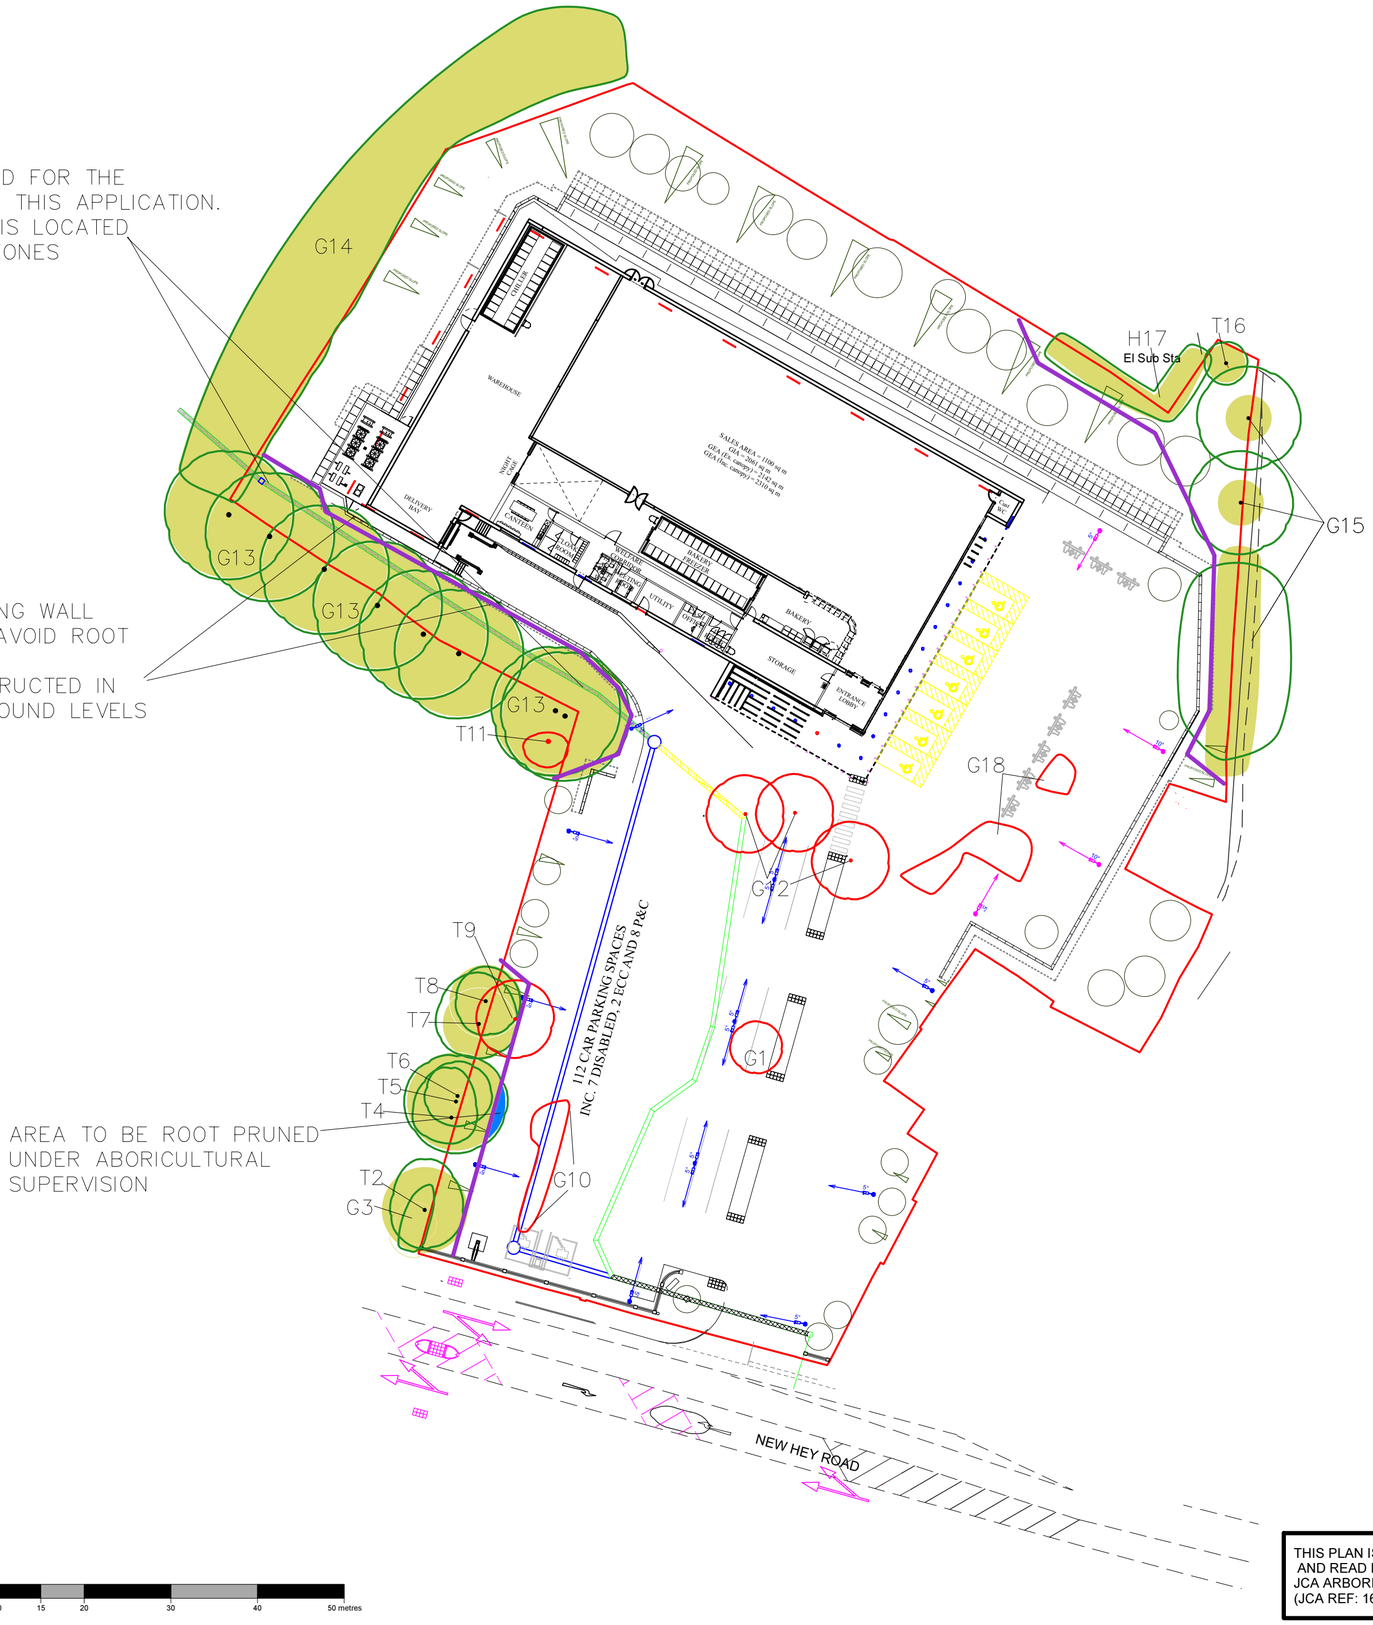

0 1 5 10 15 20 30 40 50 metres

TREE PROTECTION MEASURES

THE ROOT PROTECTION AREA (RPA) INDICATES THE LIKELY ROOTING ZONE OF A TREE.


UNLESS OTHERWISE STATED IN THE ARBORICULTURAL METHOD STATEMENT, THIS AREA NEEDS TO REMAIN UNDISTURBED.

TO ACHIEVE THIS, PROTECTIVE FENCING WILL BE INSTALLED TO ENCLOSE THE RPA TO MAKE A CONSTRUCTION EXCLUSION ZONE (CEZ);

THIS AREA IS TO BE CONSIDERED A RESTRICTED AREA; NO PEDESTRIANS, VEHICLES, THE STORAGE OF MATERIALS, EQUIPMENT OR MACHINERY ARE ALLOWED WITHIN THE CEZ, UNLESS SPECIFIED WITHIN THE ARBORICULTURAL METHOD STATEMENT.

IT IS IMPORTANT THAT THE PROTECTIVE FENCING IS CHECKED BY THE LPA OR THE ARBORICULTURAL CONSULTANT PRIOR TO ANY CONSTRUCTION WORKS BEING CARRIED OUT. IF THE TREE PROTECTION MEASURES ARE NOT CORRECTLY INSTALLED OR IF THEY DO NOT COMPLY WITH BS 5837: 2012, THIS COULD RESULT IN DAMAGE BEING CAUSED TO TREES AND CONSEQUENTLY A STOP NOTICE MAY BE SERVED BY THE LPA.

Default specification for a protective barrier

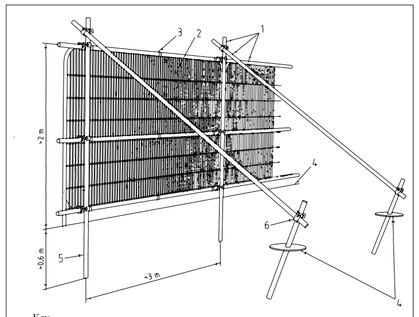

Key

1. Standard scaffold poles
2. Heavy gauge 2m tall galvanized tube and welded mesh infill panels
3. Panels secured to uprights and cross-members with wire ties
4. Ground level
5. Uprights driven into the ground until secure (minimum depth 0.6m)
6. Standard scaffold clamps

THIS PLAN IS TO BE PRINTED IN COLOUR AND READ IN CONJUNCTION WITH THE JCA ARBORICULTURAL REPORT (JCA REF: 16383-B/AJB)

Appendix 3: Tree Protection Plan

ADDRESS: New Hey Road, Salendine Nook, Huddersfield, West Yorkshire, HD3 4GS. JCA REF: 16383-B/AJB.

SCALE : 1:500	PAPER SIZE : A2

	TREE TO BE RETAINED
	TREE TO BE REMOVED
	STEM OF TREE TO BE RETAINED
	STEM OF TREE TO BE REMOVED
	ROOT PROTECTION AREA
	PROTECTIVE FENCE LINE (CEZ)
	LOCATION WHERE ROOT PRUNING IS REQUIRED UNDER ARBORICULTURAL SUPERVISION IN ORDER TO FACILITATE THE PROPOSED CAR PARK

JCA Limited

Arboricultural & Ecological Consultants

I hope that this report provides all the necessary information, but should any further advice be needed please do not hesitate to contact the author.

Signed



.....

Andrew Bussey *LANTRA Accredited PTI.*

15th March 2021 (Revised 9th September 2021)

For and on behalf of ***JCA Ltd***

Registered Office:

Unit 80
Bowers Mill
Branch Road
Barkisland
Halifax
HX4 0AD

Tel. 01422 376335
Fax. 01422 376232
Email: jon@jcaac.com

www.jcaac.com

Report printed on recycled paper

© JCA Limited 2021

JCA Ltd. Arboricultural and Ecological Consultants
Professional Tree and Ecology Advice nationwide

ARBORICULTURAL SERVICES

Guidance for Architects and Developers

- British Standard 5837 Tree Surveys
- Arboricultural Implication Assessments (AIA)
- Arboricultural Method Statements (AMS)

Advice for Engineers, Loss Adjusters and Insurers

- Tree Surveys for Subsidence
- Heave Assessment
- Tree Root Identification

Advice for Local Authorities and Social Housing

- Tree Safety Surveys
- Specialist Decay Detection
- Landscape and Orchard Design

Tree Advice for the Legal Profession

- Subsidence Litigation
- Personal Injury and Accident Investigation
- Expert Witness, Planning Inquiries and Appeals

Veteran Tree Management

- Ancient Woodland Management
- Veteran Tree Management

Tree Health and Pest and Disease Management

- Pest and Disease Surveys
- Tree Health Checks
- Disease Mitigation and Control

ECOLOGICAL SERVICES

Ecological Pre-Planning Services

- Phase 1 Habitat Surveys
- Great Crested Newt eDNA Sampling
- Protected Species: Bat, Wintering and Nesting Bird, Badger, Amphibian, Otter, Water Vole, White-Clawed Crayfish, Dormice and Reptile Surveys.
- Preparation for Environmental Impact Assessment (EIA)
- Invasive Species Surveys
- Code for Sustainable Homes

Ecological Post-Planning Services

- Biodiversity Enhancement Plans
- Protected Species Mitigation
- Ecological Management (Bat and Bird box installation and inspection)



HEAD QUARTERS:

Unit 80 Bowers Mill,
Branch Road,
Barkisland,
Halifax, HX4 0AD.

Tel: 01422 376335
Mobile: 07778 391986
Email: jon@jcaac.com
Website: www.jcaac.com

Company Reg No. 05005041
VAT No. 686 4674 78