TREE CONSULTANTS

ARBORICULTURAL REPORT

& Impact Assessment

to **BS 5837:2012** at:

Land at Penistone Road, Fenay Bridge, Huddersfield, HD8 0AS

Prepared for: *JR Planning Consultants*

Report Date: *March 2026*

Reference: *AWA7349*

0114 272 1124 / 0776 631 0880
info@awatrees.com
awatrees.com
Union Forge, 27 Mowbray Street, Sheffield S3 8EN
AWA Tree Consultants Limited. Company No. 85201
Registered in England & Wales.

ISO 9001 QUALITY MANAGEMENT
veriforce CHAS Compliant Contractor
Institute of Chartered Foresters Registered Consultant
Arboricultural Association Professional Member
QTRA Registered User

TMP006 – B
Revision 04
Auth By: APW
Date: 12/01/2026

Executive Summary

This report provides independent arboricultural advice in accordance with BS 5837:2012, regarding trees at the site in the context of a proposed residential development.

A total of 14 items of woody vegetation were surveyed, comprising 14 individual trees. Of these: 4 are low value (Category C), and 10 are unsuitable for retention (Category U).

The proposed development will not require the removal of any trees.

The layout of the development has been designed to minimise encroachment into Root Protection Areas (RPAs), with only minor incursions into a trees' RPAs, which are not expected to significantly affect tree health. Mitigation measures, including protective fencing and `no-dig' construction methods, are recommended where necessary.

The scheme presents an opportunity for new tree planting as part of a landscape strategy, offering mitigation for the removals and long-term enhancement of the site's tree cover.

Contents

1. Introduction 4
1.1 Instructions and Brief 4
1.2 Survey Details 4
2. The Site 5
2.1 Location and Description 5
3. The Trees 6
3.1 Legal 6
3.2 Tree Survey Results 7
3.3 Photographs 9
4. Arboricultural Impact Assessment 10
4.1 Proposed New Development 10
4.2 Direct Impacts 10
4.3 Indirect Impacts 10
4.4 Suitable Mitigation 11
4.5 Protection of the Retained Trees 11
5. Summary of Tree Impacts 12
6. Signature 13
Appendix 1: Authors Qualifications & Experience 15
Appendix 2: Survey Methodology and Limitations 16
Appendix 3: Explanation of Tree Descriptions 17
Appendix 4: Tree Data 18
Appendix 5: Tree Constraints Plan 19
Appendix 6: Tree Impacts Plan 20

1. Introduction

1.1 Instructions and Brief

1.1.1 We have been instructed by JR Planning Consultants to visit the site and prepare our findings in a report.

1.1.2 The report is required in accordance with BS 5837:2012 *Trees in relation to design, demolition and construction – Recommendations,* to provide detailed, independent, arboricultural advice on the trees present, in the context of potential development.

1.2 Survey Details

1.2.1 The survey took place during February 2026.

1.2.2 The trees were surveyed visually from the ground using "Visual Tree Assessment" techniques and in accordance with the guiding principles of British Standard 5837:2012.

1.2.3 Any additional off-site trees that could impact a new development design have been included in the tree survey parameters.

1.2.4 The tree positions were plotted on an Ordnance Survey map base-layer using enhanced GPS technology (1-2m accuracy) and laser distance measurer.

1.2.5 This report has been prepared by Adam Winson, Chartered Arboriculturist, MSc, BSc (Hons), MICFor, MArborA, Principal and Director of AWA Tree Consultants Ltd.

1.2.6 The tree survey data collection was carried out by Lucy Garbutt, MSc, PGCert, BSc (Hons) Biology, TechArborA, Arboriculturist at AWA Tree Consultants Ltd.

1.2.7 Full qualifications and experience are included within **Appendix 1**. Explanatory details regarding the survey methodology are included within **Appendix 2**. A full explanation of the tree data can be found at **Appendix 3**. Full details of all the trees surveyed are found in **Appendix 4**. For tree locations please refer to the Tree Constraints Plan at **Appendix 5** and for detail of the impacts of the new development refer to the Tree Impacts Plan at **Appendix 6**.

2. The Site

2.1 Location and Description

2.1.1 The site is located on Penistone Road in Fenay Bridge.

2.1.2 The site comprises a parcel of land currently used for horse grazing and stabling. To the north is a public house, to the east Penistone road and to the south and west are agricultural fields.

2.1.3 The approximate area of the survey is highlighted in the (2025 Google Earth) image below:

3. The Trees

3.1 Legal

3.1.1 The following advice is for guidance purposes only. Some trees are protected by legislation, and it is essential that the legal status of trees is established prior to carrying out works to them. Unauthorised work to protected trees could lead to prosecution, resulting in enforcement action such as fines or a criminal record. Tree Preservation Orders, Conservation Areas, Planning Conditions, Felling Licences or Restrictive Covenants legally protect many trees in the UK.

3.1.2 An online search was undertaken with Kirklees Metropoliton Borough Council on 05/03/26 to check whether any trees at the site are protected by a Tree Preservation Order or are located within a Conservation Area. As of this date **no trees at the site are protected** by a Tree Preservation Order or are within a Conservation Area.

3.1.3 Due to the large potential penalties for illegally carrying out work to protected trees, before authorising any tree works a further check should be made with the Local Planning Authority to confirm if any trees are covered by a Tree Preservation Order or are within a Conservation Area. If either applies, then statutory permission is required before any works can take place (unless such work is approved as part of full planning permission).

3.1.4 The Multi-Agency Geographical Information for the Countryside (MAGIC) website was used to search for areas of ancient woodlands listed on the Ancient Woodland (DEFRA 2021), and a check for catalogued Ancient and Veteran trees using the woodland trust ancient tree inventory (ATI) (Woodland Trust 2021).

3.1.5 It was confirmed that there are no designated ancient woodlands or veteran or ancient trees within the survey area.

3.1.6 Trees provide a wide range of habitats for many species, some of which are legally protected such as bats, nesting birds, badgers and dormice. It is essential that appropriate care is taken to ensure that this legislation is not contravened.

3.1.7 When appointing a tree surgeon, only properly qualified and experienced companies should be used, who have adequate Public Liability and Employer's Liability Insurance.

3.1.8 All tree work should be carried out according to British Standard 3998:2010 Tree Work - Recommendations.

3.2 Tree Survey Results

3.2.1 The tree survey revealed 14 items of woody vegetation, comprised of 14 individual trees.

3.2.2 Of the surveyed trees: 10 trees are retention category 'U', and 4 trees are retention category 'C' (explanatory details regarding the retention categories are included at Appendix 3).

3.2.3 Full details of the surveyed trees, tree groups and hedges are provided in the attached tree data schedule at Appendix 4. General comments are provided below:

3.2.4 The significant tree cover within the site consists mainly of several semi-mature Ash and Sycamore trees situated along the northeastern boundary of the site. There is no tree cover within the site itself, all trees are directly adjacent and likely not under site ownership.

3.2.5 Most of the trees situated within influencing distance of the site are Ash or Sycamore trees T1 – T13. These trees are all situated on top of a boundary retaining wall at a higher elevation than site itself, with many of them causing the wall to become structurally unstable and pushing stones into the field.

3.2.6 Many of the Ash along the northeastern boundary have significant signs of Ash dieback disease. Many Ash trees in the wider region are being impacted by Chalara or Ash dieback disease. Once a tree is infected, the disease is usually fatal, either directly or indirectly. While the identified Ash trees may continue to provide landscape and wildlife benefits for some time, their long-term prospects are likely to be limited as a result of Ash dieback.

3.2.7 Due to the unsuitable location of the trees, causing significant structural issues to the retaining wall, coupled with the presence of advanced Ash dieback symptoms, several of these trees require felling regardless of the development at the site. These include: T1, T2, T4, T5, T6, T7, T8, T9, T10 and T11. It is likely that these trees are not under site ownership. Prior to any removals, the owner of these trees should be informed.

3.2.8 The remaining trees within the site are of particularly low value and should not pose any significant constraint on the development potential of the site.

3.2.9 Some trees were covered in dense Ivy or were inaccessible (as detailed in Appendix 4). In such cases measurements were estimated and the condition values are indicative only.

3.2.10 The tree Root Protection Area (RPA) for each tree has been plotted as a

polygon centred on the base of the stem. Due to the presence of roads, structures, topography (and past tree management) the RPA is likely to be a simplified representation of the tree roots actual morphology and disposition. However, detailed modifications to the shape of the RPA would largely be based on conjecture and so have been avoided.

3.2.11 Some lower value tree, hedge and shrub groups do not have RPAs detailed on tree plans. The detailed extent and spread of these low value groups, in conjunction with the tree schedule, is sufficient to assess the associated potential constraints.

3.3 Photographs

Photo 1: T1 from south.

Photo 2: T1 – T11 from southwest.

Photo 3: T5 – T13 from northwest.

Photo 4: T6 and T7 from west.

Photo 5: T6 and T8 from east

Photo 6: T12 from northwest.

4. Arboricultural Impact Assessment

4.1 Proposed New Development

4.1.1 It is proposed to build a new residential development with associated access, parking, landscaping and facilities. The development proposals have been provided by my client and inform this arboricultural impact assessment and the Tree Impacts Plan at Appendix 6.

4.2 Direct Impacts

4.2.1 No trees require removal or pruning works to facilitate the development.

4.2.2 10 trees are recommended for removal regardless of the development due to their poor condition and significantly limited long-term prospects. These are: T1, T2, T4, T5, T6, T7, T8, T9, T10 and T11. It is likely that these trees are not under site ownership. Prior to any removals, the owner of these trees should be informed.

4.3 Indirect Impacts

4.3.1 The tree Root Protection Area (RPA) detailed on the Tree Plans at Appendices 5 and 6, has been used as a layout design tool, to inform on the area around a tree where the protection of the roots and soil structure is treated as a priority.

4.3.2 Potentially damaging activities are proposed in the vicinity of retained trees. The new development encroaches close to and into the edge of the RPA of T3 and T12. Construction within the RPA, can have negative impacts on tree roots. However, the encroachment is very minor, and the trees are at a higher elevation than the site itself, therefore the detailed RPA for these trees is likely to be an exaggerated representation of the trees actual rooting area. As such, significant roots will not be within these areas and the retained tree will remain largely unaffected by the works, provided care is taken during construction.

4.3.3 All the retained trees have been assessed as suitable for retention in terms of BS5837 (2012) section 5 "Proximity of structures to trees." The retained trees will not cause unreasonable inconvenience or nuisance issues to future occupiers, leading to associated pressures for felling or excessive pruning. The layout allows sufficient space to enable the retained trees to grow to maturity without significantly adversely affecting the amenity of the dwelling or amenity space.

4.3.4 The buildability of the proposed development has been assessed in terms of access, adequate working space and provision for the storage of

materials, including topsoil, in relation to the trees.

4.4 Suitable Mitigation

4.4.1 The development of the site provides an excellent opportunity to undertake new tree planting throughout the site as part of a soft landscaping scheme. As such, suitable new tree planting has the potential to mitigate for the required tree removals and, in the longer term, has the potential to improve the sites tree cover.

4.5 Protection of the Retained Trees

4.5.1 To ensure the successful retention of trees during the development process, all trees identified for retention must be physically protected from the outset of site preparation through to final landscaping. This protection should be in accordance with section 6.1 of BS:5837:2012 – Trees in Relation to Design, Demolition and Construction – Recommendations.

4.5.2 The primary method of protection will be the installation of tree protection fencing, constructed in line with the specification shown in BS 5837:2012.

4.5.3 This fencing must be installed prior to the commencement of any site clearance, demolition, or construction activity and remain in place for the duration of all potentially damaging operations.

4.5.4 The protected areas must be treated as construction exclusion zones. No materials, spoil, or equipment should be stored within these zones, and no access should be permitted.

4.5.5 Ground levels within the RPAs should be left unaltered, and care must be taken to avoid compaction of the soil structure, which could have long-term impacts on tree health.

4.5.6 If conditioned by the Local Planning Authority, an associated Arboricultural Method Statement (AMS) and Tree Protection Plan (TPP) detailing protective fencing locations and specifications, construction methods close to the retained trees, and any required site monitoring, can be provided.

4.5.7 The AMS and TPP explain how and when the protection measures will be installed and maintained throughout the development. They are designed to be referenced for practical guidance on how to protect the retained trees at the site to ensure contractors do not accidentally damage trees during construction.

5. Summary of Tree Impacts

Tree/ Group Ref	***Value***	***Impact Type***	***Description of Impact***	***Impact Level***	***Mitigation / Solution***
T3 and T12	C (Low)	Indirect – RPA encroachment	Within footprint of development area	None	None
T1, T2, T4, T5, T6, T7, T8, T9, T10 and T11	U (Unsuitable)	Direct - Removal	Unsuitable to retain regardless of development	Not applicable	Work to British Standard 3998:2010

6. Signature

I trust this report provides all the required information.

Signed

.....

Adam Winson, *Chartered Arboriculturist, MSc, BSc (Hons), MICFor, ACIEEM*

5th March 2026

AWA Tree Consultants Limited
Union Forge
27 Mowbray Street
Sheffield
S3 8EN

www.awatrees.com

Our Charity Partner: Kids Plant Trees

At AWA Tree Consultants, we are proud to partner with the local charity, Kids Plant Trees. This collaboration allows us to support a cause that reflects our commitment to trees and the environment while making a positive impact on local communities.

Kids Plant Trees is a grassroots charity dedicated to improving tree equity by planting trees in underserved areas with limited green spaces, often in communities facing higher levels of deprivation.

We are proud to support their mission to create greener, healthier environments for future generations.

Appendices

Appendix 1: Authors Qualifications and Experience
Appendix 2: Survey Methodology and Limitations
Appendix 3: Explanation of Tree Descriptions
Appendix 4: Tree Data
Appendix 5: Tree Constraints Plan
Appendix 6: Tree Impacts Plan

Appendix 1: Authors Qualifications & Experience

Adam Winson: ***Chartered Arboriculturist, MSc, BSc (Hons), MICFor, MArborA, QTRA + VALID Registered***
Adam is the company Director and Principal Consultant. He has a mix of the highest-level academic qualifications and relevant work experience. He has worked within the tree care profession for over 25 years and was awarded an MSc in Arboriculture and Urban Forestry, with distinction. Adam is a Chartered Arboriculturist and a Registered Consultant with the Institute of Chartered Foresters, a Professional Member of the Arboricultural Association and he has original research published by the UK Forestry Commission. His work ranges from individual expert tree inspections to managing trees on major infrastructure projects. His work often involves trees with preservation orders or litigation, and he has appeared as a tree expert, at planning appeal hearings up to the crown court. Adam also regularly undertakes locum Tree Officer work for several Local Planning Authorities.

James Brown: ***Chartered Arboriculturist, BSc (Hons) Arboriculture, MICFor, MArborA, PTI (Lantra), QTRA Registered***
James is a highly experienced and qualified Arboricultural Consultant. He is a Chartered Arboriculturist and a Professional Member of the Arboricultural Association, and he has a BSc (Hons) in Arboriculture, attaining first class honours, as well as being awarded the Institute of Chartered Foresters student award. James joined AWA in 2016, he has many years' experience as an Arboricultural Consultant, he previously worked in Europe's largest container tree nursery and he has experience of local authority Tree Officer work.

James Godfrey: ***BA (Hons), FdSc Arboriculture and Tree Management, TechArborA, PTI (Lantra), QTRA Registered*** James has had extensive arboricultural experience working as an arborist within the public and private sector. While working at AWA, James completed his FdSc in Arboriculture and Tree Management, graduating with a distinction and was also awarded for achieving the highest overall mark in his year. James has used his arboricultural knowledge to inform and carry out accurate tree surveys and produce detailed reports that aim to balance appropriate tree retention with the requirements of landowners.

Joe Thomas: ***MSci Biology, L4 Dip Arboriculture, TechArborA, PTI (Lantra), QTRA Registered***
Joe achieved a first class degree in Biology with an integrated Masters (MSci) from the University of Sheffield. Additionally, he has a Level 4 Diploma in Arboriculture. Joe joined AWA in 2022 after an Urban Forestry role with the Sheffield and Rotherham Wildlife Trust and Sheffield City Council, where he gained a variety of experience in different aspects of the arboriculture sector.

Lucy Garbutt: ***MSc, PGCert, BSc (Hons) Biology, PTI (Lantra), TechArborA, QTRA Registered***
Lucy graduated with a masters degree in Animal Behaviour from the UK's highest rated university, St Andrews of Scotland, immediately following the completion of her BSc degree in Biology from Lancaster University. Lucy has experience in botany and plant science and moved into arboriculture after previous experience of protected species and botanical surveys with a large environmental consulting company.

Sophie Beckerman: ***BA (Hons), Dip Arboriculture Level 4, PTI (Lantra), TechArborA, QTRA + VALID Registered***
Sophie has more than 10 years' experience as an arborist, working for a variety of private companies as well as undertaking tree management with Sheffield City Council Ranger Service and The Wildlife Trust. Her expertise in arboriculture is demonstrated in the practical NPTC qualifications gained, and her excellent knowledge is reflected in the L4 diploma in Arboriculture, which she completed while working. Her roles as a climbing arborist and team leader included estimating for jobs and project management, supervising tree contracting teams - ensuring that work is carried out safely and efficiently and that health and safety standards are adhered to, and risk assessments are carried out.

Ross Lane: ***FdSc Environmental Conservation, Diploma Arboriculture, TechArborA, PTI (Lantra), QTRA + VALID Registered***
Ross has a diverse background spanning horticulture, arboriculture, and ecology. Ross has extensive experience conducting surveys throughout the UK and has worked on projects of all sizes, including major infrastructure projects such as HS2. In his previous role as a Tree Inspector at Derbyshire County Council, projects involved managing the county wide tree stock in relation to the ash dieback response and contributing to ambitious County Council targets of planting a million trees. Possessing technician-level membership with the Arboricultural Association, coupled with a comprehensive range of qualifications from tree risk assessment to habitat management, underscores Ross' dedication in professional arboriculture.

Brandon Townsend: ***BSc (Hons) Biology, L4 (Arb) Apprentice, QTRA Registered***
Brandon is an Arboricultural Technician at AWA, currently completing the Level 4 Arboriculture Apprenticeship at Myerscough College. He holds a BSc (Hons) in Biology from Bangor University, where he developed a strong interest in woodland ecology. Before joining AWA in April 2024, he gained practical arboricultural experience and completed his NPTC chainsaw qualification. Brandon supports a range of consultancy work including tree surveys, risk assessments, and technical reporting, and is developing skills in specialist inspection methods such as PiCUS tomography.

Appendix 2: Survey Methodology and Limitations

The survey was undertaken in accordance with British Standard 5837:2012 *Trees in relation to design, demolition and construction – Recommendations.* The trees were assessed objectively and without reference to any proposed site layout. The trees were surveyed from the ground using 'Visual Tree Assessment' (VTA) methodology. VTA is appropriate and is endorsed by industry guidance. It is used by arboriculturists to evaluate the structural integrity of a tree, relying on observation of trees biomechanical and physiological features. Measurements are obtained using a diameter tape, clinometer, laser distometer and loggers tape. Where this is not practical measurements are estimated. Tree groups have been identified in instances as defined in BS 5837:2012. Shrubs and insignificant trees may have been omitted from the survey.

This report represents a BS 5837:2012 tree survey and should not be accepted as a detailed tree safety inspection report; however, tree related hazards are recorded and commented upon where observed, yet no guarantee can be given as to the absolute safety or otherwise of any individual tree. All recommended tree work must be to BS 3998:2010 - '*Tree Work: Recommendations*'.

The findings and recommendations contained within this report are valid for a period of twelve months from the date of survey. The author shall not be responsible for events which happen after this time due to factors which were not apparent at the time, and the acceptance of this report constitutes an agreement with these guidelines and terms.

Appendix 3: Explanation of Tree Descriptions

HEIGHT of the tree is measured from the stem base in metres. Where the ground has a significant slope the higher ground is selected.

CROWN HEIGHT is an indication of the average height at which the crown begins.

STEM DIAMETER is measured at 1.5 metres above (higher) ground level. Where the tree is multi-stemmed at this point; the diameter is measured close to ground level or else a combined stem diameter is calculated.

CROWN SPREAD is measured from the centre of the stem base to the tips of the branches in all four cardinal points.

AGE CLASS of the tree is described as young, semi-mature, early-mature, mature, or over-mature.

PHYSIOLOGICAL CONDITION is classed as good, fair, poor, or dead. This is an indication of the health of the tree and takes into account vigour, presence of disease and dieback.

STRUCTURAL CONDITION is classed as good, fair or poor. This is an indication of the structural integrity of the tree and takes into account significant wounds, decay and quality of branch junctions.

LIFE EXPECTANCY is classed as; less than 10 years, 10-20 years, 20-40 years, or more than 40 years. This is an indication of the number of years before removal of the tree is likely to be required.

Retention Categories

A (marked in green on Appendix 5) = retention most desirable. These trees are of very high quality and value with a good life expectancy.

B (marked in blue on Appendix 5) = retention desirable. These trees are of good quality and value with a significant life expectancy.

C (marked in grey on Appendix 5) = trees which could be retained. These trees are of low or average quality and value, and are in adequate condition to remain until new planting could be established.

U (marked in red on Appendix 5) = trees unsuitable for retention. These trees are in such a condition that any existing value would be lost within 10 years.

	Tree Species			Measurements				Crown (m)					Tree Condition							Value		Management
Tree ID	***Common Name***	***Latin Name***	***Maturity***	***Height (m)***	***Stems***	***Stem Diameter (mm)***	***Estimated***	***Crown height***	***N***	***E***	***S***	***W***	***Roots***	***Stem***	***Crown***	***Comments***	***Physiological***	***Structural***	***Life Expectancy***	***Amenity***	***Category***	***Works***
T1	Sycamore	*Acer pseudoplatanus*	Early-mature	18	6	200 avg.	Yes	4	6	7.5	7.5	7.5	Limited access around base	Multiple stemmed at base. Vertical. Epicormic growths. Old pruning wounds. Stubs. Ivy covered	Old pruning wounds. Minor deadwood	Heavily Ivy covered preventing detailed inspection at base. Retaining wall has failed at base likely due to tree roots. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Fair	Poor	<10 yrs	Moderate	U	Removal recommended regardless of the development.
T2	Ash	*Fraxinus excelsior*	Semi-mature	8	1	200	Yes	6	1	1	1	1	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs. Ivy covered	Old pruning wounds. Minor deadwood. Moderate dieback	Retaining wall has failed at base likely due to tree roots. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Poor	Fair	<10 yrs	Low	U	Removal recommended regardless of the development.
T3	Sycamore	*Acer pseudoplatanus*	Semi-mature	8	1	200	Yes	2	1.5	1.5	2	1.5	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs. Ivy covered	Old pruning wounds. Minor deadwood	Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Fair	Fair	10 to 20 yrs	Low	C	No works recommended.
T4	Ash	*Fraxinus excelsior*	Semi-mature	9	1	200	Yes	3	1.5	1.5	1.5	1	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs	Old pruning wounds. Minor deadwood. Moderate dieback	Advanced symptoms of Ash Dieback. Retaining wall has failed at base likely due to tree roots. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Poor	Poor	<10 yrs	Low	U	Removal recommended regardless of the development.

	Tree Species			Measurements				Crown (m)					Tree Condition							Value		Management
Tree ID	***Common Name***	***Latin Name***	***Maturity***	***Height (m)***	***Stems***	***Stem Diameter (mm)***	***Estimated***	***Crown height***	***N***	***E***	***S***	***W***	***Roots***	***Stem***	***Crown***	***Comments***	***Physiological***	***Structural***	***Life Expectancy***	***Amenity***	***Category***	***Works***
T5	Ash	*Fraxinus excelsior*	Semi-mature	6	1	150	Yes	3	2	1	1	2	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs	Old pruning wounds. Minor deadwood. Moderate dieback	Advanced symptoms of Ash Dieback. Retaining wall has failed at base likely due to tree roots. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Poor	Poor	<10 yrs	Low	U	Removal recommended regardless of the development.
T6	Ash	*Fraxinus excelsior*	Semi-mature	11	1	300	Yes	2	2.5	2	3	3	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Pruning wounds from crown lifting	Old pruning wounds. Minor deadwood. Moderate dieback	Advanced symptoms of Ash Dieback. Retaining wall has failed at base likely due to tree roots. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Poor	Poor	<10 yrs	Low	U	Removal recommended regardless of the development.
T7	Ash	*Fraxinus excelsior*	Semi-mature	8	1	150	Yes	2	1	2	1	1.5	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs	Old pruning wounds. Minor deadwood. Moderate dieback	Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Fair	Poor	<10 yrs	Low	U	Removal recommended regardless of the development.
T8	Ash	*Fraxinus excelsior*	Semi-mature	7	2	100, 150	Yes	2	2	0.5	1.5	3	Limited access around base	Single stemmed. Significant lean. Old pruning wounds. Stubs	Old pruning wounds. Minor deadwood. Moderate dieback	Moderate lean west. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Advanced symptoms of Ash Dieback. Ownership unclear.	Poor	Poor	<10 yrs	Low	U	Removal recommended regardless of the development.

	Tree Species			Measurements				Crown (m)					Tree Condition							Value		Management
Tree ID	***Common Name***	***Latin Name***	***Maturity***	***Height (m)***	***Stems***	***Stem Diameter (mm)***	***Estimated***	***Crown height***	***N***	***E***	***S***	***W***	***Roots***	***Stem***	***Crown***	***Comments***	***Physiological***	***Structural***	***Life Expectancy***	***Amenity***	***Category***	***Works***
T9	Sycamore	*Acer pseudoplatanus*	Early-mature	14	5	100, 250, 300, 300, 300	Yes	3	7	6	7	7	Limited access around base	Vertical. Multiple stemmed at 0.5m. Epicormic growths. Old pruning wounds. Stubs	Old pruning wounds. Minor deadwood	Retaining wall has failed at base likely due to tree roots. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Good	Fair	<10 yrs	Moderate	U	Removal recommended regardless of the development.
T10	Ash	*Fraxinus excelsior*	Semi-mature	8	1	200	Yes	2	0.5	3	3	1.5	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs	Old pruning wounds. Moderate dieback. Minor deadwood	Unbalanced crown due to adjacent tree. Retaining wall has failed at base likely due to tree roots. Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Advanced symptoms of Ash Dieback. Ownership unclear.	Poor	Fair	<10 yrs	Low	U	Removal recommended regardless of the development.
T11	Ash	*Fraxinus excelsior*	Semi-mature	7	1	250	Yes	2	0.5	1.5	3	3	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs	Old pruning wounds. Minor deadwood. Moderate dieback	Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Advanced symptoms of Ash Dieback. Ownership unclear.	Poor	Poor	<10 yrs	Low	U	Removal recommended regardless of the development.
T12	Sycamore	*Acer pseudoplatanus*	Early-mature	14	3	200, 350, 350	Yes	2	5	5	6	7	Limited access around base	Multiple stemmed at base. Vertical. Epicormic growths. Old pruning wounds. Stubs	Old pruning wounds. Minor deadwood. Minor dieback	Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Fair	Fair	10 to 20 yrs	Moderate	C	No works recommended.

	Tree Species			Measurements				Crown (m)					Tree Condition							Value		Management
Tree ID	***Common Name***	***Latin Name***	***Maturity***	***Height (m)***	***Stems***	***Stem Diameter (mm)***	***Estimated***	***Crown height***	***N***	***E***	***S***	***W***	***Roots***	***Stem***	***Crown***	***Comments***	***Physiological***	***Structural***	***Life Expectancy***	***Amenity***	***Category***	***Works***
T13	Sycamore	*Acer pseudoplatanus*	Semi-mature	14	5	100, 100, 200, 200, 250	Yes	2	4	5	4	6	Limited access around base	Multiple stemmed at base. Vertical. Old pruning wounds. Epicormic growths. Stubs	Old pruning wounds. Minor deadwood. Minor dieback	Has been pruned over the road historically. On a retaining wall at a higher level to the site itself. Ownership unclear.	Good	Fair	10 to 20 yrs	Moderate	C	No works recommended.
T14	Ash	*Fraxinus excelsior*	Early-mature	15	1	450	Yes	2	6	5	3	5	Limited access around base	Single stemmed. Vertical. Epicormic growths. Old pruning wounds. Stubs. Ivy covered	Old pruning wounds. Minor dieback. Minor deadwood	Within adjacent field. Ownership unclear.	Fair	Fair	10 to 20 yrs	Low	C	No works recommended.

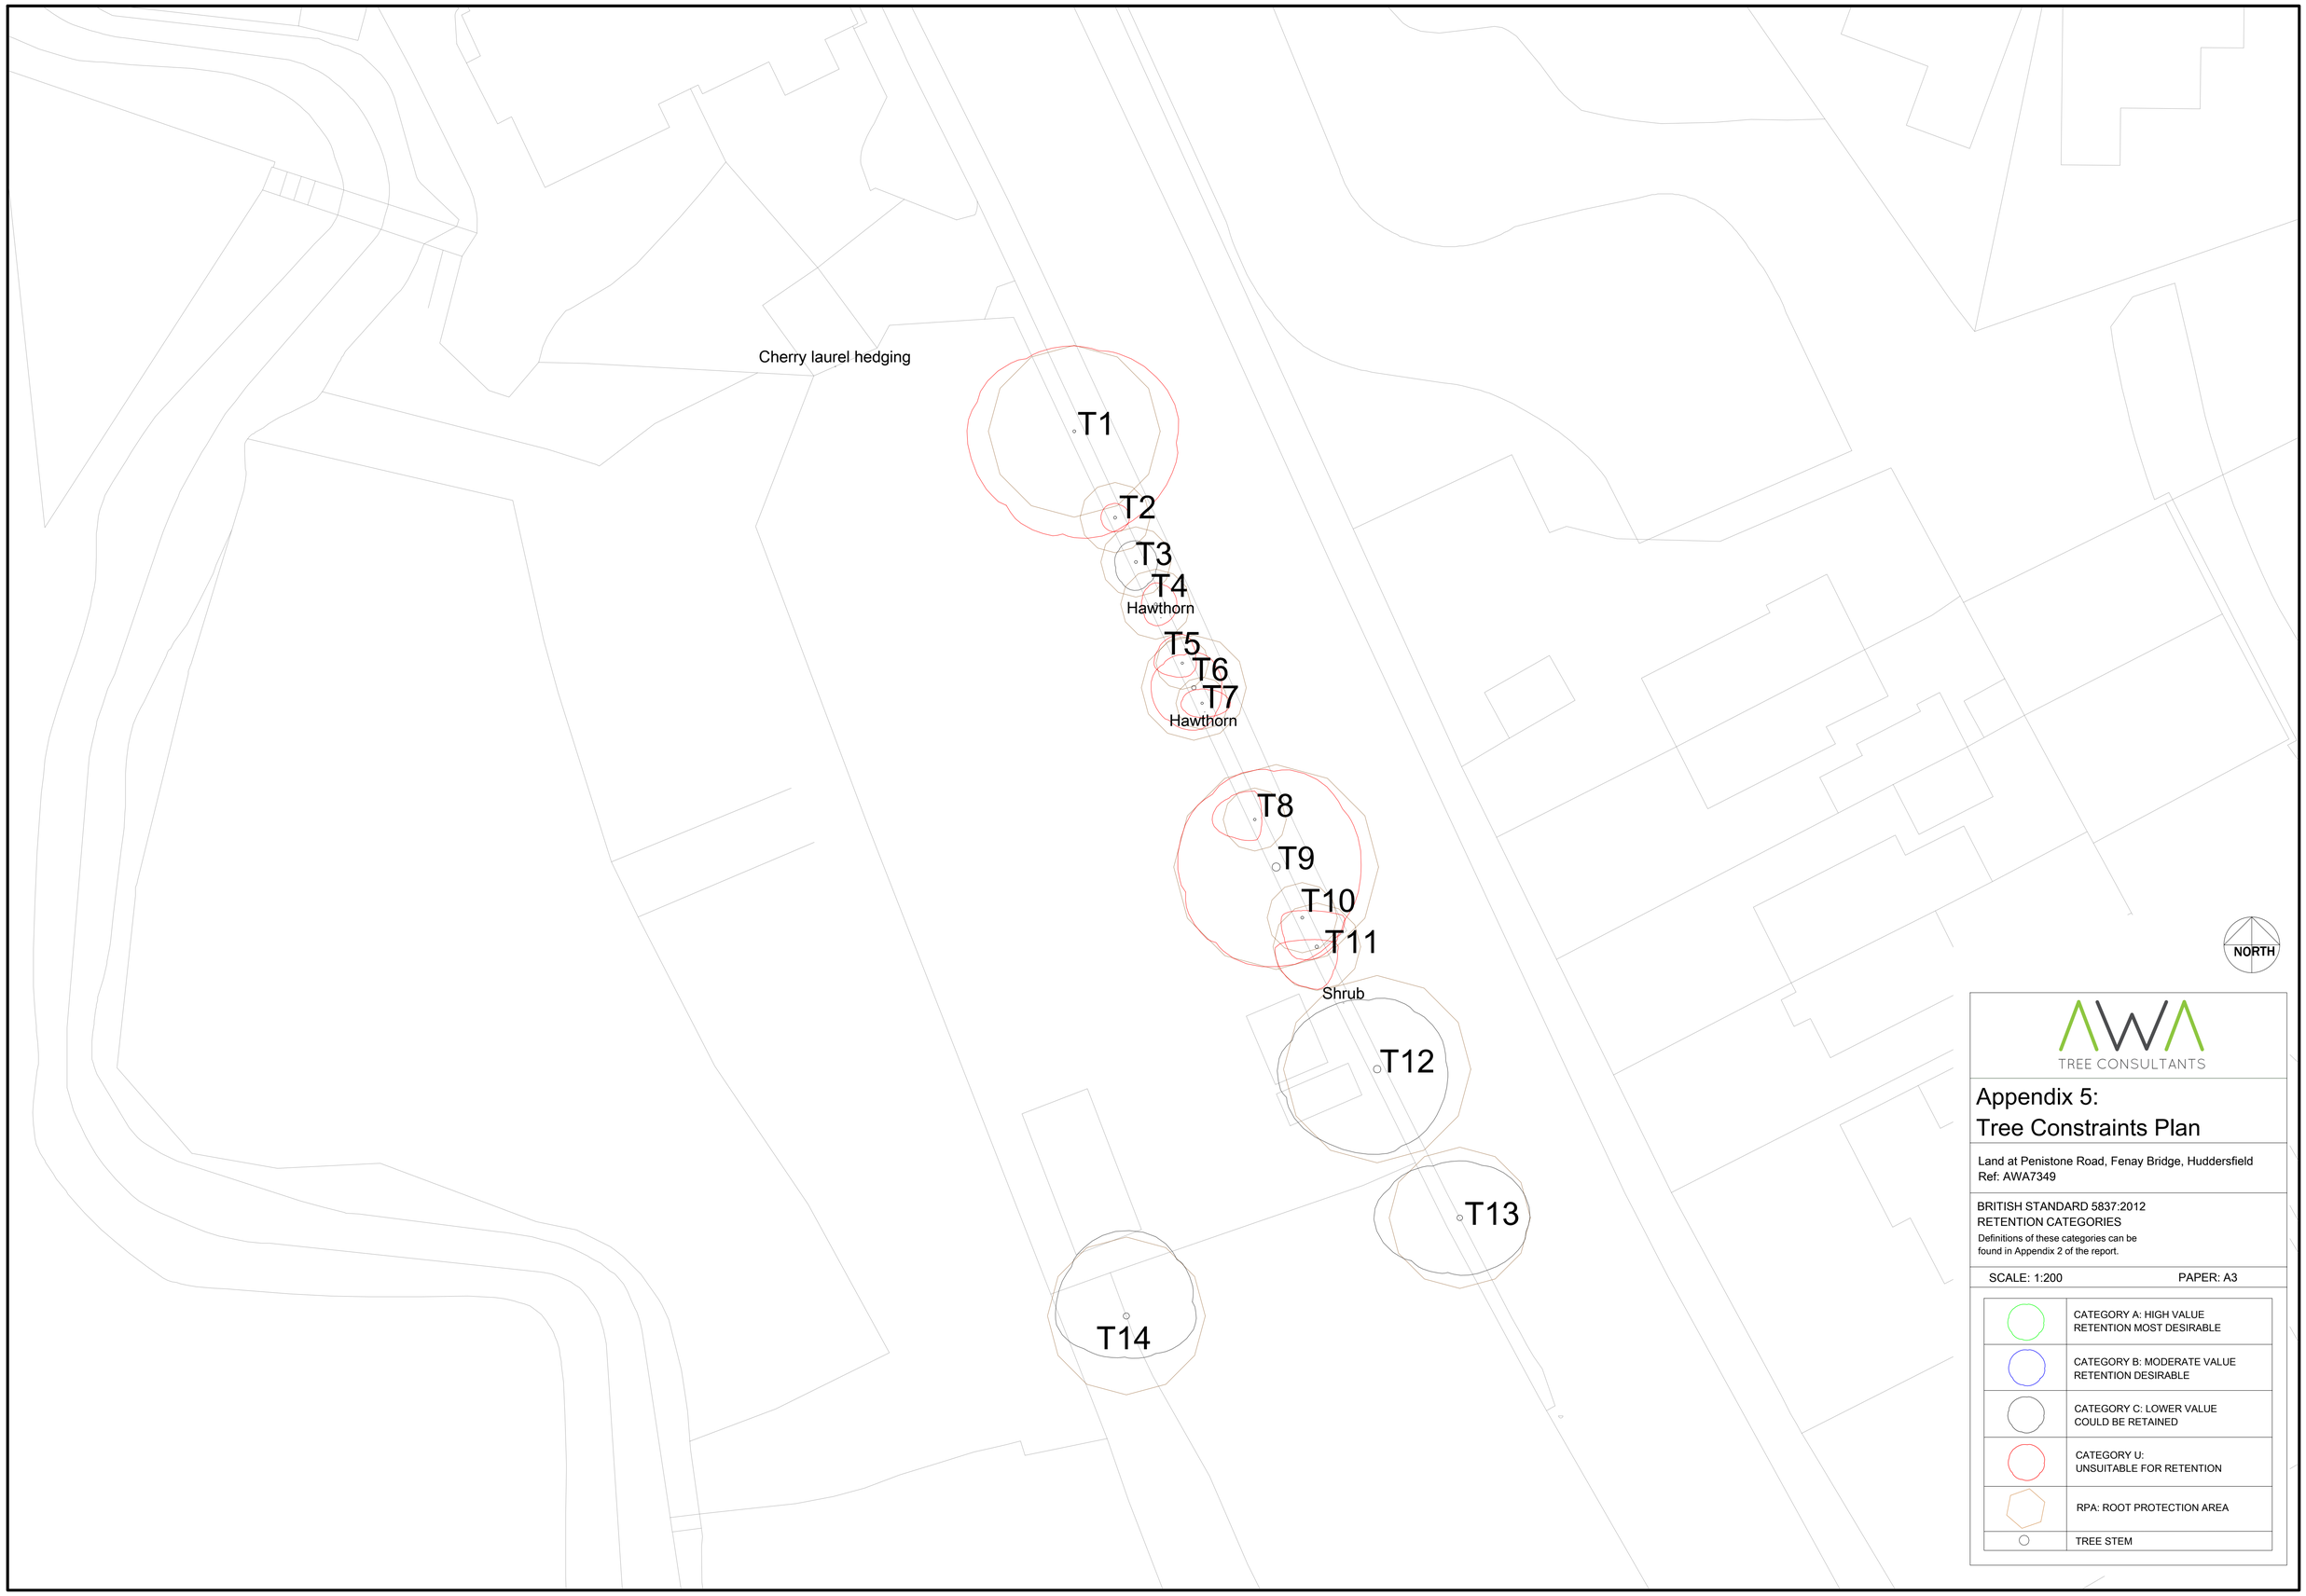
Cherry laurel hedging
T1
T2
T3
T4
Hawthorn
T5
T6
T7
Hawthorn
T8
T9
T10
T11
Shrub
T12
T13
T14
NORTH
AWA
TREE CONSULTANTS
Appendix 5:
Tree Constraints Plan
Land at Penistone Road, Fenay Bridge, Huddersfield
Ref: AWA7349
BRITISH STANDARD 5837:2012
RETENTION CATEGORIES
Definitions of these categories can be
found in Appendix 2 of the report.
SCALE: 1:200
PAPER: A3
CATEGORY A: HIGH VALUE
RETENTION MOST DESIRABLE
CATEGORY B: MODERATE VALUE
RETENTION DESIRABLE
CATEGORY C: LOWER VALUE
COULD BE RETAINED
CATEGORY U:
UNSUITABLE FOR RETENTION
RPA: ROOT PROTECTION AREA
TREE STEM

FB
SITE ACCESS
Cherry laurel hedging
PERMEABLE TARMAC
1.8M HIGH STONE WALLS + PIERS
NEW GATES 1.8M HIGH
EXISTING RETAINING WALL
NEW NATIVE HEDGEROW MIN 6M IN LENGTH
FB
T1
T2
T3
T4
Hawthorn
T5
T6
T7
Hawthorn
PENISTONE ROAD
23
SITE AREA
1.75 ha
TIMBER POST & RAIL FENCE 1.2M HIGH APPROX
GRASS CRETE DRIVE
EXISTING RETAINING WALL
T8
3NO PARKING SPACES
T9
TURNING AREA
T10
T11
EXISTING GATE
Shrub
TIMBER POST & RAIL FENCE 1.2M HIGH APPROX
T12
EXISTING RETAINING WALL
PAVING
TIMBER POST & RAIL FENCE 1.2M HIGH APPROX
T13
EXISTING GATE
TIMBER POST & RAIL FENCE 1.2M HIGH APPROX
T14
MS
NORTH
AWA
TREE CONSULTANTS
Appendix 6:
Tree Impacts Plan
Land at Penistone Road, Fenay Bridge, Huddersfield
Ref: AWA7349
BRITISH STANDARD 5837:2012
SCALE: 1:200
PAPER: A3
TREE/ TREE GROUP/ HEDGE TO BE RETAINED
TREE/ TREE GROUP/ HEDGE TO BE REMOVED REGARDLESS OF DEVELOPMENT
TREE/ TREE GROUP/ HEDGE TO BE REMOVED TO FACILITATE DEVELOPMENT
RPA: ROOT PROTECTION AREA
TREE STEM