181	Bedroom			
Heritage Significance	Low			
Description of Significance	This along with adjacent en-suite formed a singular bedroom space under the 1898 plans which remained as such in 1938 and was subdivided in the 1950s to create the current layout. Fireplace loss and new opening to RC formed in 1930s works, moderate level of significance in respect of plan and form with much of the exception of the entrance door panelling and skirting to the external and flanking walls. Note window reveals appear to be 1970s encasement works. Moderate significance mostly due to largely original plan form. Low significance to the en-suite partition and modern finishes and fixtures and fittings throughout. Historic water damage to the outer wall has revealed there to be post 1930s in nature (brown gypsum sections) and it should be noted that the room has received a number of panelling works to the fireplace recess and the entrance door panelling and architraves. Ceilings hold loss due to indeterminate turn of the century in age and water damage extensive. Notable elements of significance in this room is the timberwork generally comprising window reveal, architraves and some wall skirting. The door reveals retain their 1930s architraves and skirting blocks but note there is evidence of newer reveal casement and reseting of these architraves.			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3.- Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: Yes	New Door opening in existing Wall: No		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Window panelling to reveals to be reinstated (Where required) & redecorated			
Works to Doors (External)	N/A			
Works to Doors (Internal)	New internal door to be installed within existing frames (where possible to do so). Otherwise, new frames & architraves to match existing			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901. Door architraves to be retained where possible.			
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

182	En-Suite			
Heritage Significance	Detrimental			
Description of Significance	As 176			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: Yes		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	N/A			
Works to Doors (External)	N/A			
Works to Doors (Internal)	New internal opening to be formed in existing wall. New frames to match existing.			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
M&E Works	Exposed services within corridor spaces concealed via expanded mesh ceiling raft with integral lighting. Refer to MEP drawings for more information.			

176	En-Suite			
Heritage Significance	Detrimental			
Description of Significance	Under 1898 plans formerly part of the sittingroom for bedroom 175 - considered total material loss due to comprehensive subdivision works in the 1930s and 1970s. Current layout is a combination of 1930s plasterboard works evident). Chief window appears to be from 1930s period (handle shape and glass) but of no unique significance 1930s architraves to doorway noted. Detrimental designation due to loss of plan form use as sitting room etc.			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: No		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Existing window to be removed and opening to be made good			
Works to Doors (External)	N/A			
Works to Doors (Internal)	New fake internal door to be installed within existing frames (where possible to do so). Otherwise, new frames & architraves to match existing.			
Miscellaneous	Retain and restore doorway architraves			
M&E Works	Exposed services within corridor spaces concealed via expanded mesh ceiling raft with integral lighting. Refer to MEP drawings for more information.			

X69	Circ.			
Heritage Significance	High			
Description of Significance	this space has remained largely unaltered from the 1898 form with the exception of the blocking of the doorway to bedroom 175 in the 1930s. The 1898 plans show a doorway to the left of the 1930s fire place and chimney adjoining X69. All brickwork to openings and skirtings appear to be 1898 in origin with little adaptation. the ceilings appear to be in the 1930s style of coffering and coving but investigations have determined these to be of 1960s onwards origin. High significance defined by its plan form largely unaltered from original construction with ornate timberwork remaining.			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: No		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	N/A			
Works to Doors (External)	N/A			
Works to Doors (Internal)	N/A			
Miscellaneous	Ceiling to be removed replaced if required for compliance and reinstated in the same recorded form/ pattern. Retain and restore doorway architraves, walls (in plaster), window architraves and reveal panelling (remove overboarding). 1930s door architraves.			
M&E Works	Exposed services within corridor spaces concealed via expanded mesh ceiling raft with integral lighting. Refer to MEP drawings for more information.			

175	Bedroom			
Heritage Significance	Moderate			
Description of Significance	Under 1898 plans this formed a singular bedroom with end has an original dedicated doorway into bedroom 176 which was blocked off in the 1930s works. Current opening formed in the 1930s to connect to general WC 178 which was closed off in 1970s works. Central opening appear to be 1970s recreation mouldings to cornice works. Significance derives largely from largely unamended 1898 plan form and remaining 1898 skirtings and window timberwork/ reveal boxings			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3.- Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: Yes	New Door opening in existing Wall: No		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Window panelling to reveals to be reinstated (Where required) & redecorated			
Works to Doors (External)	N/A			
Works to Doors (Internal)	New internal door to be installed within existing frames (where possible to do so). Otherwise, new frames & architraves to match existing			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901. Door architraves to be retained where possible. Retain and restore doorway architraves, walls (in plaster), window architraves and reveal panelling (remove overboarding). 1930s door architraves.			
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

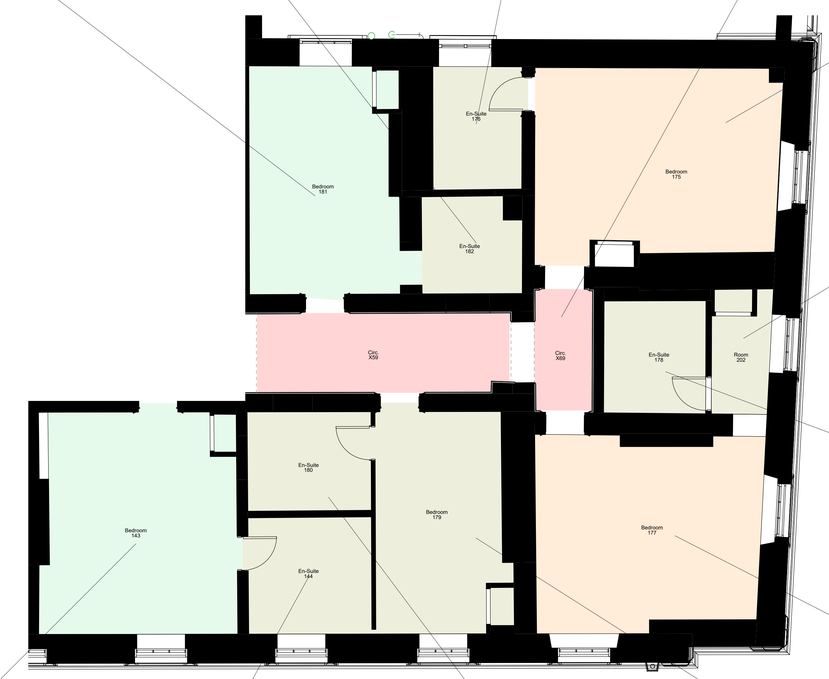

143	Bedroom			
Heritage Significance	Low			
Description of Significance	This along with adjacent en-suite formed a singular bedroom space under the 1898 plans which remained as such in 1938 and was subdivided in the 1950s to create the current layout. Fireplace loss and new opening to RC formed in 1930s works, moderate level of significance in respect of plan and form with much of the exception of the entrance door panelling and skirting to the external and flanking walls. Note window reveals appear to be 1970s encasement works. Moderate significance mostly due to largely original plan form. Low significance to the en-suite partition and modern finishes and fixtures and fittings throughout. Historic water damage to the outer wall has revealed there to be post 1930s in nature (brown gypsum sections) and it should be noted that the room has received a number of panelling works to the fireplace recess and the entrance door panelling and architraves. Ceilings hold loss due to indeterminate turn of the century in age and water damage extensive. Notable elements of significance in this room is the timberwork generally comprising window reveal, architraves and some wall skirting. The door reveals retain their 1930s architraves and skirting blocks but note there is evidence of newer reveal casement and reseting of these architraves.			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3.- Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: Yes	New Door opening in existing Wall: No		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Window panelling to reveals to be reinstated (Where required) & redecorated			
Works to Doors (External)	N/A			
Works to Doors (Internal)	New false internal door to be installed within existing frames (where possible to do so). Otherwise, new frames & architraves to match existing. New internal door within new opening formed in existing wall, new frames & architraves to match existing			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901. Note: Door architraves to be retained/ restored as should be the window reveal cloathing (remove 1970s boarding) and architraves.			
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

144	En-Suite			
Heritage Significance	Detrimental			
Description of Significance	See 143.- detrimental as interruption to plan form of 1898 and 1930s and modernised extensively in 1970s/ 80s. Window reveal panelling and architraves (appear to be 1930s in origin).			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: Yes		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Window panelling to reveals to be reinstated (Where required) & redecorated			
Works to Doors (External)	N/A			
Works to Doors (Internal)	Existing door opening to be infilled.			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901. Retain and restore window reveal panelling and architraves (appear to be 1930s in origin).			
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

180	En-Suite			
Heritage Significance	Detrimental			
Description of Significance	1970s intervention formed from bedroom 179 - detrimental definition due to loss of plan form (former bedroom)			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: Yes	New Door opening in existing Wall: Yes		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	N/A			
Works to Doors (External)	N/A			
Works to Doors (Internal)	New internal door to be installed within new opening in existing wall. New frames & architraves to match existing.			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
M&E Works	Refer to MEP drawings for more information.			

179	Bedroom			
Heritage Significance	Detrimental			
Description of Significance	under 1898 and 1930s plans this formed a singular bedroom with ensuite 180 and 144 door and window architraves remain, Ceilings appear to be 1970s recreation mouldings to cornice works.			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: Yes		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Window panelling to reveals to be reinstated (Where required) & redecorated			
Works to Doors (External)	N/A			
Works to Doors (Internal)	N/A			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901. Door reveal architraves to be retained/ restored as should be the window reveal cloathing (remove 1970s boarding) and architraves. Skirtings deemed total loss as are ceilings.			
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

177	Bedroom			
Heritage Significance	Moderate			
Description of Significance	plan form largely unchanged as a bedroom under 1898 and 1930s plans .Fireplace loss and new opening to RC formed in 1930s works, moderate level of significance in respect of plan and form with much of the 1898 skirtings and general timberwork remaining (some door architraves upgraded to 1930s profiles). Moderate significance mostly due to largely original plan form. Existing remains. note extensive water damage to all external wall plaster and ceilings deemed total loss.			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3.- Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 3 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: No		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Window panelling to reveals to be reinstated (Where required) & redecorated			
Works to Doors (External)	N/A			
Works to Doors (Internal)	New internal door to be installed within existing frames (where possible to do so). Otherwise, new frames & architraves to match existing.			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901. Door reveal architraves to be retained/ restored as should be the window reveal cloathing (remove 1970s boarding) and architraves. Recommend retention of external and flanking wall skirtings. Best endeavours should be undertaken to retain and restore in place skirtings where practicable.			
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

202	Room			
Heritage Significance	Detrimental			
Description of Significance	As 178.- Window reveal panelling and architraves remain			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2.- Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: Yes		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	Window panelling to reveals to be reinstated (Where required) & redecorated			
Works to Doors (External)	N/A.			
Works to Doors (Internal)	New internal door to be installed within existing frames (where possible to do so). Otherwise, new frames & architraves to match existing.			
Miscellaneous	New furniture throughout. Refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901. window architraves and reveal panelling (remove overboarding) to be retained			
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

178	En-Suite			
Heritage Significance	Detrimental			
Description of Significance	under 1898 plans this formed a wide bathroom room 202 off the circulation X69 (general bathroom) Under 1930s works this was separated into 2m bathrooms horizontally, later 1950s alterations appear to have separated these into 3m vertically separated en-suites/ shower rooms. Detrimental designation due to comprehensive material loss and loss of plan form definition of understanding.			
Demolition	Strip-out Floor: Yes	Strip-out Ceiling: Yes	Strip-out Wall: Yes	Strip-out FF&E: Yes
	Refer to Demolition Plans			
Works to Floor	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2.- Refer to drawing L054-AHR-20-BA-ZZ-DA-20300. New floor finishes to be provided throughout, refer to interior design strategy L054-AHR-ZZ-ZZ-ZZ-T-108901.			
Works to Ceiling	Enhancement to existing floor structure to provide fire & acoustic compliance. Floor type 2 - Refer to drawing L054-AHR-20-BA-ZZ-DA-20300.			
Works to Walls	New Partition with Skirting: No	New Door opening in existing Wall: No		
	Make good of all existing plaster to external walls. Where works is required to the existing wall plaster, the following hierarchy of repair is to be applied. Whole skims as required - Gypsum multiskim. Light cracking - wet brush, localise, skim and gypsum. Deep crack and former elec chases - remove all gypsum, infill to 40mm with lime plaster, skim and gypsum multiskim.			
Works to Windows	N/A			
Works to Doors (External)	N/A			
Works to Doors (Internal)	N/A			
Miscellaneous				
M&E Works	MVHR to be installed within en-suite ceiling void utilising existing chimney stacks to vent to atmosphere. Fan coil units installed within newly formed bulkheads to provide heating & cooling. All ductwork concealed within dropped ceiling (Refer to MEP drawings for further details)			

(20) Heritage Scoping General Notes & Key

Heritage Significance Key

- Considerable
- High
- Moderate
- Low
- Neutral
- Detrimental

Drawings to be read in conjunction with the following drawing packages.

Demolition Plans

L054-AHR-20-ZZ-ZZ-DA-A-20010 - Ground & Mezzanine Floor Demolition Plan
L054-AHR-20-01-ZZ-DA-A-20012 - First Floor Demolition Plan
L054-AHR-20-02-ZZ-DA-A-20013 - Second Floor Demolition Plan
L054-AHR-20-ZZ-03-DA-A-20014 - Third Floor Demolition Plan
L054-AHR-20-ZZ-04-DA-A-20015 - Fourth Floor Demolition Plan
L054-AHR-20-ZZ-B1-DA-A-20016 - Basement Level Demolition Plan
L054-AHR-20-ZZ-RF-DA-A-20017 - Roof Level Demolition Plan

Proposed Plans

L054-AHR-ZZ-ZZ-00-DA-A-20700 - Proposed Ground Floor Plan (Planning)
L054-AHR-ZZ-ZZ-M0-DA-A-20701 - Proposed Mezzanine Floor Plan (Planning)
L054-AHR-ZZ-ZZ-01-DA-A-20702 - Proposed First Floor Plan (Planning)
L054-AHR-ZZ-ZZ-02-DA-A-20703 - Proposed Second Floor Plan (Planning)
L054-AHR-ZZ-ZZ-03-DA-A-20704 - Proposed Third Floor Plan (Planning)
L054-AHR-ZZ-ZZ-04-DA-A-20705 - Proposed Fourth Floor Plan (Planning)
L054-AHR-ZZ-ZZ-B1-DA-A-20706 - Proposed Basement Floor Plan (Planning)
L054-AHR-ZZ-ZZ-ZZ-DA-A-20707 - Proposed Roof Plan (Planning)

Refurbishment Strategy Drawings

L054-AHR-20-BA-00-D-A-20201 - Ground Floor Reception - Refurbishment Strategy
L054-AHR-20-BA-00-D-A-20202 - Ground Floor Reception Elevations - Refurbishment Strategy
L054-AHR-20-BA-00-D-A-20203 - Conference Room - Refurbishment Strategy
L054-AHR-20-BA-01-D-A-20204 - Former Dining Room - Refurbishment Strategy
L054-AHR-20-BA-00-D-A-20205 - Former Signing Room - Refurbishment Strategy

Interior Design Strategy

L054-AHR-ZZ-ZZ-ZZ-T-IA6901 - Interior Design Strategy

P1	Issued for Planning	22.04.2025	DR / MS
Rev	Description	Date	Dr by / App by
original by: DR		date created: 02/01/2025	Approved by: MS

AHR Architects Ltd
No.1 Aire Street
Leeds
LS1 4PR
United Kingdom

T +44(0)113 3858787
E leeds@ahr.co.uk
www.ahr.co.uk

client name: GMI Construction Group

project: George Hotel Refurbishment

drawing: Third Floor Heritage Scoping Plan - Sheet 2

computer file: V:\0-3\1-1\1290_Profiled_Folder_redirection\daniel.ritson\Documents\Revit Files\Local Files\Revit Central - 2024_R24_SW-MA-D20231_daniel.ritson.rvt

plot date:

project number: 2024.00373.000

scale: As indicated@A0

drawing number: L054-AHR-20-BA-03-D-A-20046

rev: P1

issue status: S2

This drawing is to be read in conjunction with all related drawings. All dimensions must be checked and verified on site before commencing any work or producing shop drawings. The originator should be notified immediately of any discrepancy.
This drawing is copyright and remains the property of AHR.

N

SCALE 1 : 50
0 1 2 3

03 **Level 03 - Third Floor Heritage Scoping Plan - Sheet 2**
1 : 50