

Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: [www.apecuk.org/data](http://www.apecuk.org/data)

|                                |                 |                |            |             |
|--------------------------------|-----------------|----------------|------------|-------------|
| Site Air Test Certificate Ref: | ST/26/9/28/GBR1 | Date of Issue: | 28/09/2026 | Page 1 of 6 |
|--------------------------------|-----------------|----------------|------------|-------------|

**Note:** Inspection undertaken in accordance with APEC in-house Methods QCRF2, OH1 and OH2, based on the HSE publication HSG 248 'The Analysts Guide'

|                                                                            |                                                                                                   |                                                                                                   |
|----------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------|
| <b>Site:</b><br>Bishops Court<br>Floors 15 + 16<br>Huddersfield<br>HD4 7PL | <b>Client:</b><br>One Group Solutions Ltd<br>Newtown Road<br>Marlow<br>Buckinghamshire<br>SL7 1LQ | <b>Contractor:</b><br>One Group Solutions<br>Newtown Road<br>Marlow<br>Buckinghamshire<br>SL7 1LQ |
| <b>Contact:</b> .                                                          | <b>Contact:</b> Abbie Smith                                                                       | <b>Contact:</b> N/A                                                                               |

### Samples taken by (APEC)

|                |              |                         |                                                                                   |             |            |
|----------------|--------------|-------------------------|-----------------------------------------------------------------------------------|-------------|------------|
| <b>Analyst</b> | Chris Butler | <b>Signed by (APEC)</b> |  | <b>Date</b> | 28/09/2026 |
|----------------|--------------|-------------------------|-----------------------------------------------------------------------------------|-------------|------------|

### Air Testing


### Purpose of Test

|                     |                          |                      |                          |           |                          |                 |                          |                  |                                     |
|---------------------|--------------------------|----------------------|--------------------------|-----------|--------------------------|-----------------|--------------------------|------------------|-------------------------------------|
| Far-Source Sampling | <input type="checkbox"/> | Near-Source sampling | <input type="checkbox"/> | Leak Test | <input type="checkbox"/> | Background Test | <input type="checkbox"/> | Reassurance Test | <input checked="" type="checkbox"/> |
|---------------------|--------------------------|----------------------|--------------------------|-----------|--------------------------|-----------------|--------------------------|------------------|-------------------------------------|

### Site Photograph and Additional Site Information

|                                                                                    |                                                                                          |                                                                      |  |  |
|------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------|----------------------------------------------------------------------|--|--|
|  | <b>Area Assessed:</b>                                                                    | Floors 15 + 16                                                       |  |  |
|                                                                                    | <b>Description of reason for test (including the nature and extent of ACMs removed):</b> | Reassurance air monitoring following the removal of textured coating |  |  |
|                                                                                    | <b>Site Specific Risk Assessment:</b>                                                    | <b>Project Information Sheet (if used):</b>                          |  |  |
|                                                                                    | RA/26/9/28/GBR1                                                                          | -                                                                    |  |  |

### Sample Area Layout Plan

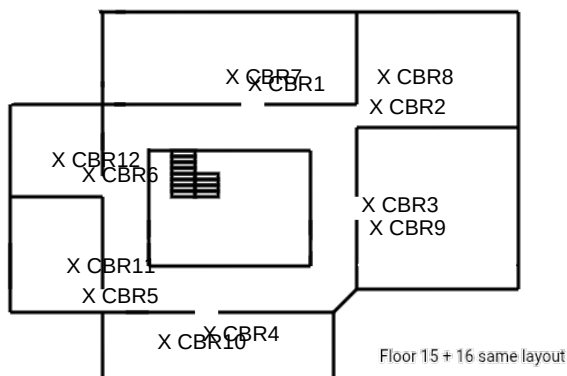

Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: [www.apecuk.org/data](http://www.apecuk.org/data)

|                                |                 |                |            |             |
|--------------------------------|-----------------|----------------|------------|-------------|
| Site Air Test Certificate Ref: | ST/26/9/28/CBR1 | Date of Issue: | 28/09/2026 | Page 2 of 6 |
|--------------------------------|-----------------|----------------|------------|-------------|

## Air Test Summary

[illegible]

The calculated result is derived from the formula published in HSG 248, The Analysts Guide;  $C = 1000 N D^2 / V n d^2$ , where:  
**N** = Number of fibres counted; **D** = Diameter of exposed filter area; **V** = Collected volume of sample; **n** = number of fields counted;  
**d** = measured diameter of Walton Beckett graticule

**Analysts' Comments (Opinions expressed are outside of the scope of our UKAS accreditation)**

Samples 1;2;4 and 6 unreadable due to amount of dust on filter

## Findings of Testing and Analysis

The measured respirable airborne fibre concentrations are below the limit of quantification and no remedial measures are considered necessary

One or more of the measured respirable airborne fibre concentrations are elevated and remedial measures have been advised to the client or contractor representative


Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: [www.apecuk.org/data](http://www.apecuk.org/data)


|                                |                 |                |            |             |
|--------------------------------|-----------------|----------------|------------|-------------|
| Site Air Test Certificate Ref: | ST/26/9/28/CBR1 | Date of Issue: | 28/09/2026 | Page 3 of 6 |
|--------------------------------|-----------------|----------------|------------|-------------|

### Photographs

Photograph 1



Photograph 2



Photograph 3



Photograph 4



Sampling pump (sample ref: 26/9/A/28/CBR1)



Sampling pump (sample ref: 26/9/A/28/CBR2)



Sampling pump (sample ref: 26/9/A/28/CBR3)



Sampling pump (sample ref: 26/9/A/28/CBR4)



Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: [www.apecuk.org/data](http://www.apecuk.org/data)

Site Air Test Certificate Ref:

ST/26/9/28/CBR1

Date of Issue:

28/09/2026

Page 4 of 6

### Photographs

Sampling pump (sample ref: 26/9/A/28/CBR5)



Sampling pump (sample ref: 26/9/A/28/CBR6)



Sampling pump (sample ref: 26/9/A/28/CBR7)



Sampling pump (sample ref: 26/9/A/28/CBR8)



Sampling pump (sample ref: 26/9/A/28/CBR9)



Sampling pump (sample ref: 26/9/A/28/CBR10)



Sampling pump (sample ref: 26/9/A/28/CBR11)



Sampling pump (sample ref: 26/9/A/28/CBR12)



Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: [www.apecuk.org/data](http://www.apecuk.org/data)

|                                |                 |                |            |             |
|--------------------------------|-----------------|----------------|------------|-------------|
| Site Air Test Certificate Ref: | ST/26/9/28/CBR1 | Date of Issue: | 28/09/2026 | Page 5 of 6 |
|--------------------------------|-----------------|----------------|------------|-------------|

| Photographs |  |
|-------------|--|
|             |  |
|             |  |
|             |  |
|             |  |
|             |  |

Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: [www.apecuk.org/data](http://www.apecuk.org/data)

|                                |                 |                |            |             |
|--------------------------------|-----------------|----------------|------------|-------------|
| Site Air Test Certificate Ref: | ST/26/9/28/CBR1 | Date of Issue: | 28/09/2026 | Page 6 of 6 |
|--------------------------------|-----------------|----------------|------------|-------------|

**Note:** Inspection undertaken in accordance with APEC in-house Methods QCRF2, OH1 and OH2, based on the HSE publication HSG 248 'The Analysts Guide'

|                                                            |                                                                                 |                                                                             |
|------------------------------------------------------------|---------------------------------------------------------------------------------|-----------------------------------------------------------------------------|
| <b>Site:</b>                                               | <b>Client:</b>                                                                  | <b>Contractor:</b>                                                          |
| Bishops Court<br>Floors 15 + 16<br>Huddersfield<br>HD4 7PL | One Group Solutions Ltd<br>Newtown Road<br>Marlow<br>Buckinghamshire<br>SL7 1LQ | One Group Solutions<br>Newtown Road<br>Marlow<br>Buckinghamshire<br>SL7 1LQ |
| <b>Contact:</b>                                            | <b>Contact:</b> Abbie Smith                                                     | <b>Contact:</b> N/A                                                         |

## Appendix 1 - Additional Air Test Information

**Notes:**

1. This information supplements the air test results in the Air Test Certificate and is only valid in conjunction with those results.
2. Temperature is recorded in **Kelvin (K)**, Pressure is recorded in **mmHg**, Flowrates are recorded in **litres per minute (l/min)**, Sample volume is recorded in **litres**
3. Interim flow checks are only carried out where the overall sample period exceeds approximately 1 hour
4. All testing and analysis is undertaken with reference to APEC' task specific risk assessments TRA 01 and TRA 02
5. Analysis has been undertaken in accordance with methods described in HSG248, The Analysts guide. The reported results are based on a count of all respirable fibres sampled.

## APEC Analytical Equipment

|                                   |                   |                         |        |                                                                                     |      |                   |             |                                |       |
|-----------------------------------|-------------------|-------------------------|--------|-------------------------------------------------------------------------------------|------|-------------------|-------------|--------------------------------|-------|
| Flow Meter                        | FM52              | Barometer               | N/A    | Thermometer                                                                         | N/A  | Stop Watch        | SW17        | Effective filter diameter (mm) | 22.60 |
| Stage Micrometer No               | SM03              | Measured Graticule dia. | 100    | HSE / NPL Test Slide No.                                                            | PC32 | No. of bands seen | 5           | Microscope Number              | APM19 |
| Samples counted by (APEC Analyst) | Chris Butler      |                         | Signed |  |      | Date Analysed     | 28/09/2026  | Analysis Location (Site / Lab) | Lab   |
| Test Protocol:                    | 4L (Re-assurance) |                         |        |                                                                                     |      |                   | Checked by: | N/A                            |       |

|                                         |                                                                                   |                                     |                                     |                         |
|-----------------------------------------|-----------------------------------------------------------------------------------|-------------------------------------|-------------------------------------|-------------------------|
| <b>Suitability of Counting Location</b> | <b>Location assessed and adequate (if not record details in Analyst Comments)</b> | <input checked="" type="checkbox"/> | <b>Counting Location (describe)</b> | Site Welfare Facilities |
|-----------------------------------------|-----------------------------------------------------------------------------------|-------------------------------------|-------------------------------------|-------------------------|

| Sample Number   | Pump No. | Head No. | Temp | Pressure | Start Flow | Start Time | Interim Flow | Interim Time | End Flow | End Time |
|-----------------|----------|----------|------|----------|------------|------------|--------------|--------------|----------|----------|
| 26/9/A/28/CBR1  | AHFSY16  | 9A       | N/A  | N/A      | 8.4        | 09:18      | -            | --:--        | 8.4      | 10:18    |
| 26/9/A/28/CBR2  | AHFSY17  | 9B       | N/A  | N/A      | 8.4        | 09:19      | -            | --:--        | 8.4      | 10:19    |
| 26/9/A/28/CBR3  | AHFSY18  | 9C       | N/A  | N/A      | 8.4        | 09:20      | -            | --:--        | 8.4      | 10:20    |
| 26/9/A/28/CBR4  | AHFSY19  | 9D       | N/A  | N/A      | 8.4        | 09:21      | -            | --:--        | 8.4      | 10:21    |
| 26/9/A/28/CBR5  | AHFSY20  | 9E       | N/A  | N/A      | 8.4        | 09:22      | -            | --:--        | 8.4      | 10:22    |
| 26/9/A/28/CBR6  | AHFSY21  | 9F       | N/A  | N/A      | 8.4        | 09:23      | -            | --:--        | 0.0      | 10:23    |
| 26/9/A/28/CBR7  | AHFSY16  | 9G       | N/A  | N/A      | 8.4        | 11:06      | -            | --:--        | 8.4      | 12:06    |
| 26/9/A/28/CBR8  | AHFSY17  | 9H       | N/A  | N/A      | 8.4        | 11:07      | -            | --:--        | 8.4      | 12:07    |
| 26/9/A/28/CBR9  | AHFSY18  | 9I       | N/A  | N/A      | 8.4        | 11:08      | -            | --:--        | 8.4      | 12:08    |
| 26/9/A/28/CBR10 | AHFSY19  | 9J       | N/A  | N/A      | 8.4        | 11:09      | -            | --:--        | 8.4      | 12:09    |
| 26/9/A/28/CBR11 | AHFSY20  | 9K       | N/A  | N/A      | 8.4        | 11:09      | -            | --:--        | 8.4      | 12:09    |
| 26/9/A/28/CBR12 | AHFSY21  | 9L       | N/A  | N/A      | 8.4        | 11:10      | -            | --:--        | 8.4      | 12:10    |

## Analysts in Training

To be signed off by the lead analyst where the analyst carrying out the inspection and testing is working under supervision as part of training.

|                       |  |                         |  |              |  |
|-----------------------|--|-------------------------|--|--------------|--|
| <b>Trainer / Lead</b> |  | <b>Signed by (APEC)</b> |  | <b>Date:</b> |  |
| <b>Trainee</b>        |  | <b>Signed by (APEC)</b> |  | <b>Date:</b> |  |