

**KEY:-**  
 --- To be demolished.

**BLOCK B & C**  
 Areas as shown to be demolished. External walls as shown to be retained, Block B, boundary wall. Block C, John William Street facade.

**Note reference**  
 X-Y-Z  
 Floor(X)-Category(Y)-Note number(Z)

**BLOCK A**  
**00 Ground Floor Level**  
**Walls Removed:**  
 0-1-1 Phasing:1960's Significance:Detrimental  
 0-1-2 Infill partition Phasing:Phase 5 to present day Significance:Low  
 0-1-3 Infill partition Phasing:Phase 5 to present day Significance:Low  
 0-1-4 Internal partition Phasing:1930's Significance:Detrimental  
 0-1-5 Phasing:1930's Significance:Detrimental  
 0-1-6 Phasing:1930's Significance:Detrimental  
**Doors Removed:**  
 0-2-1 Double Doors to be removed. Refer to photo.  
 0-2-2 Existing door and blanking panel to be removed. Architrave and frame to be retained. Refer to photo.  
**Openings formed:**  
 0-3-1 Phasing:1851 Significance:High  
 0-3-2 Phasing:1851 Significance:High  
 0-3-3 Phasing:1851-74 Significance:Moderate, Fireplace to be removed (later).  
 0-3-4 Phasing:1851 Significance:High  
 0-3-5 Phasing:Phase 5 to present day Significance:Detrimental  
**Demolition - other:**  
 0-4-1 Bar and bar above, sliding partition to be removed. Refer to photo.  
 0-4-2 Internal staircase to be removed. Refer to photo.  
 0-4-3 Existing full height service riser (later) and fabric in existing wall to be removed to form new opening.Phasing:1851 Significance:High  
 0-4-4 Existing staircase to be removed. Refer to photo.  
 0-4-5 Existing staircase to be removed. Refer to photo.  
 0-4-6 Existing staircase and double door to be removed. Refer to photo.

**BLOCK A**  
**00 Ground Floor Level**  
 0-J1 Existing building to be removed. Wall to be made good.  
 0-J2 Existing building to be removed. Wall to be made good.  
 0-J3 Existing building to be removed. Wall to be made good.  
 0-J4 Existing building to be removed. Wall to be made good.  
 0-J5 Existing building to be removed. Wall to be made good.  
 0-J6 Existing building to be removed. Wall to be made good.

Also refer to drawing P320 for details



Block A Level 00 Layout Demolition  
 1 : 100

P1	Planning Issue	20/12/22	RAB	JR
	Revision	Date	By	Chk

All dimensions to be verified on site, and the Architect informed of any discrepancy. All drawings and specifications should be read in conjunction with the Health and Safety Plan; all conflicts should be reported to the appointed Principal Designer.



Kirklees Council  
 The George Hotel  
 Huddersfield, HD1 1JA

Sheet Name: Level 00 Demolition


Purpose of issue: Planning Status: \_\_\_\_\_

Date: AUG 2022 Checked by: RS

Drawn by: AR Scale @ A1: 1 : 100

Project No: 8662 Revision: P1

Drawing No: 8662-BOW-ZZ-00-DR-A-P105

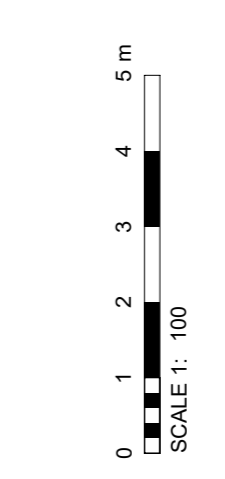

Do not scale from this drawing. This drawing is the copyright of Bowman Riley Architects Limited. © C:\Users\matthew.cummings\Documents\8662-BOW-ZZ-DR-A-0001 - The George Hotel - Building\_mattthew.cummings\SL.PLT