

Monitoring Details:

Crack and Level Monitoring


Provider Name: My Home Needs	Monitoring Interval: Every 8 weeks
Instruction Date: 27/06/2022	Number of Visits: MUFN
Reading Date:	Visits Completed: 6
Date of Issue: 31/01/2024	Visits Outstanding: MUFN

Client Details:

Client: Davies	Engineer / Handler: -
Job Reference: 72126981	

Monitored Address:

Occupier:
Address: 46 West Park Street, Drewsbury, WF13 4LD
Telephone:
Email:

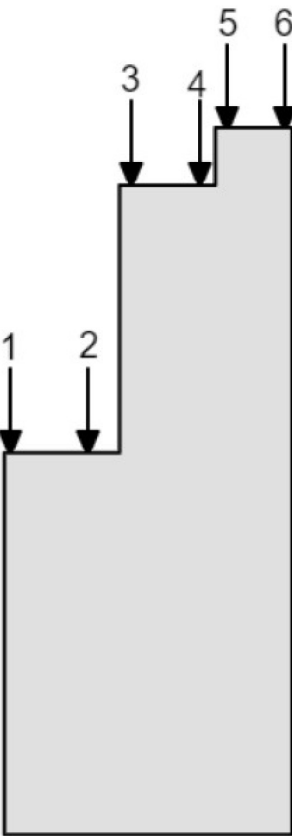


Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
TBM1	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	10.0000	
2	10.0305	10.0310	10.0314	10.0306	10.0312	10.0311	10.0315	
3	9.8028	9.8011	9.8024	9.8008	9.8013	9.8015	9.8022	
4	9.7645	9.7619	9.7635	9.7629	9.7615	9.7625	9.7642	
5	10.8395	10.8354	10.8380	10.8377	10.8361	10.8372	10.8386	
6	10.8441	10.8421	10.8447	10.8453	10.8432	10.8436	10.8453	
Taken by	N/A	N/A	N/A	N/A	N/A	N/A	KP	
Serial number	001	001	002	004	101	004	1212045	


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
TBM1	0	0	0	0	0	0	0	
2	0	+0.5	+0.9	+0.1	+0.7	+0.6	+1	
3	0	-1.7	-0.4	-2	-1.5	-1.3	-0.6	
4	0	-2.6	-1	-1.6	-3	-2	-0.3	
5	0	-41	-15	-18	-34	-23	-0.9	
6	0	-2	+0.6	+1.2	-0.9	-0.5	+1.2	

Level Readings Chart (Points TBM 1 - 6)

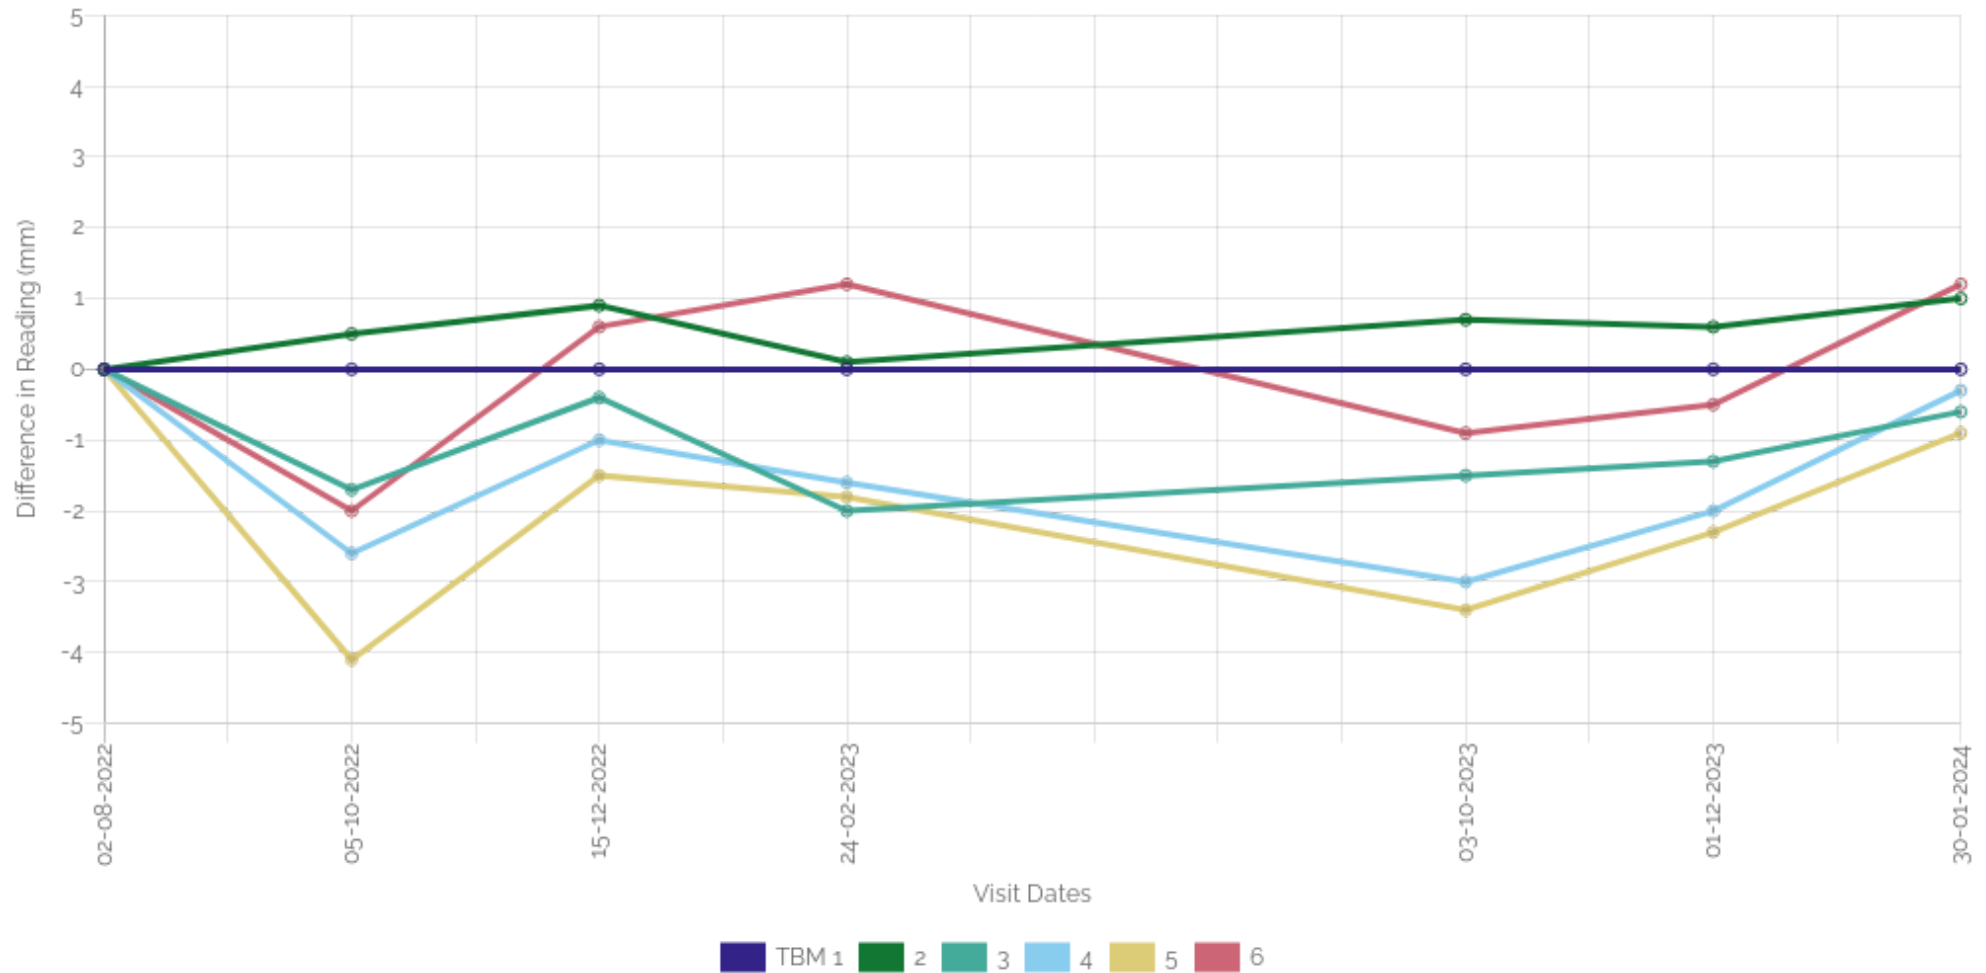

Relative Movement (Relative Survey, for illustration purposes only)

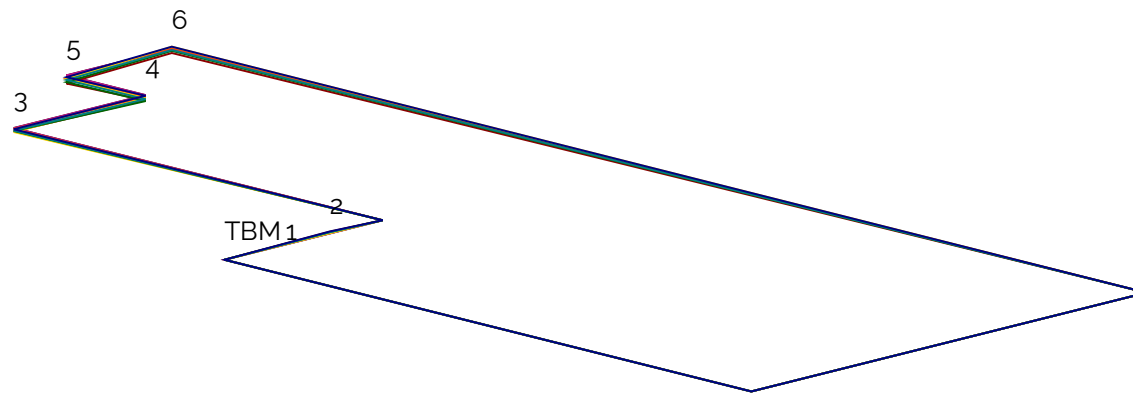

01/08/2022	04/10/2022	15/12/2022	24/02/2023	02/10/2023	01/12/2023	30/01/2024


Crack Monitoring

Kitchen above unit

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	65	64.7	63.68	63.49	63.34	62.94	62.74	
V	70.23	70.3	70.35	70.35	69.79	70.06	69.96	
D	93.21	93.07	91.8	91.55	91.72	91.15	90.96	
Taken by	N/A	N/A	N/A	N/A	N/A	N/A	KP	
Callipers	001	001	002	004	101	004	101	

Kitchen above unit - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	0	-0.3	-1.32	-1.51	-1.66	-2.06	-2.26	
V	0	0.07	0.12	0.12	-0.44	-0.17	-0.27	
D	0	-0.14	-1.41	-1.66	-1.49	-2.06	-2.25	

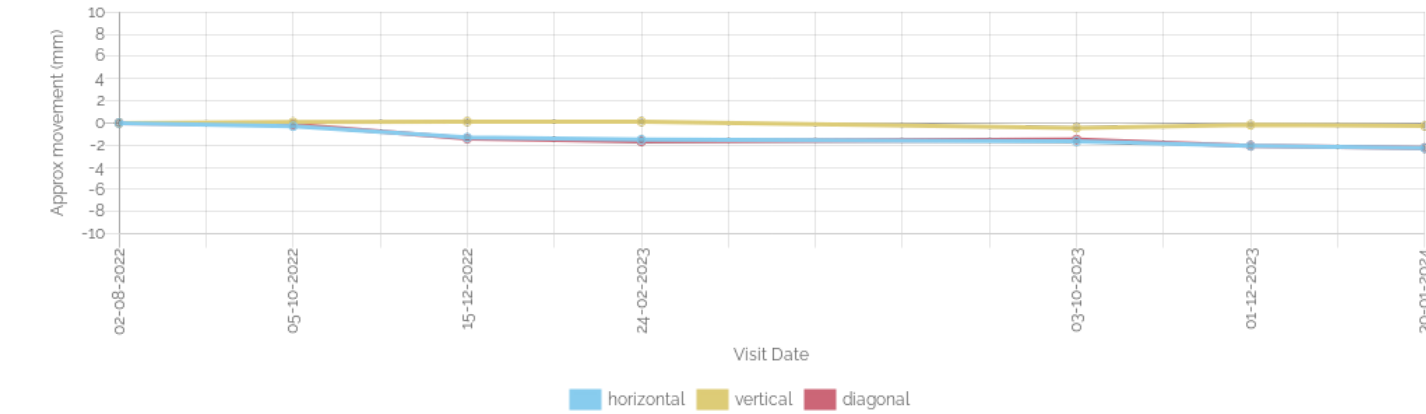

Kitchen above unit - Photo




Crack Monitoring

Landing left wall

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	68.96	73.1	72.78	72.7	72.9	72.67	72.02	
V	80.62	80.75	81.02	81.12	80.21	80.76	80.88	
D	105	105.07	105.06	105.1	104.67	104.81	104.69	
Taken by	N/A	N/A	N/A	N/A	N/A	N/A	KP	
Callipers	001	001	002	004	101	004	101	

Landing left wall - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	0	4.14	3.82	3.74	3.94	3.71	3.06	
V	0	0.13	0.4	0.5	-0.41	0.14	0.26	
D	0	0.07	0.06	0.1	-0.33	-0.19	-0.31	

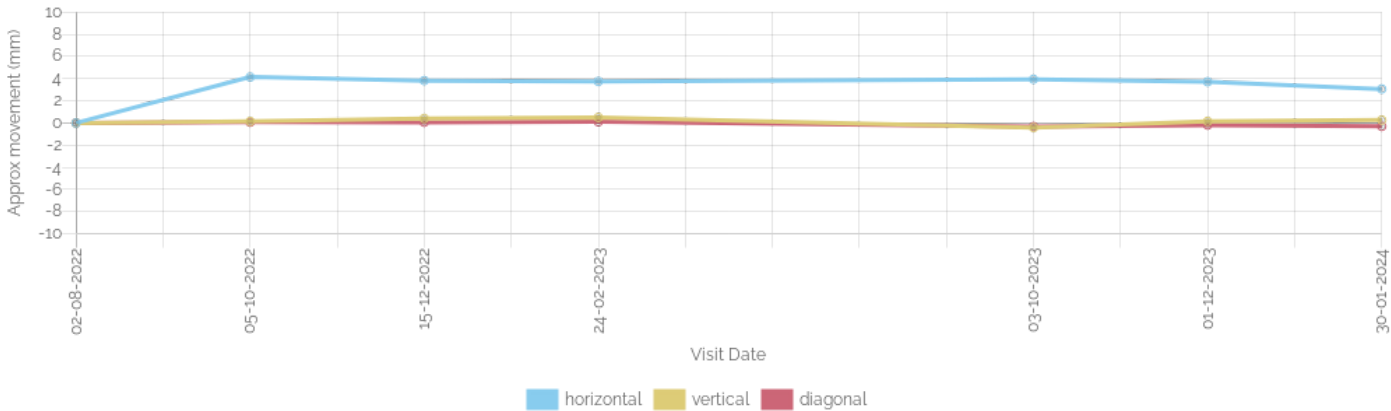

Landing left wall - Photo




Crack Monitoring

Landing right wall

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	109.67	114.82	113.8	112.97	115.13	114.34	112.86	
Taken by	N/A	N/A	N/A	N/A	N/A	N/A	KP	
Callipers	001	001	002	004	101	004	101	

Landing right wall - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	0	515	413	33	546	467	319	

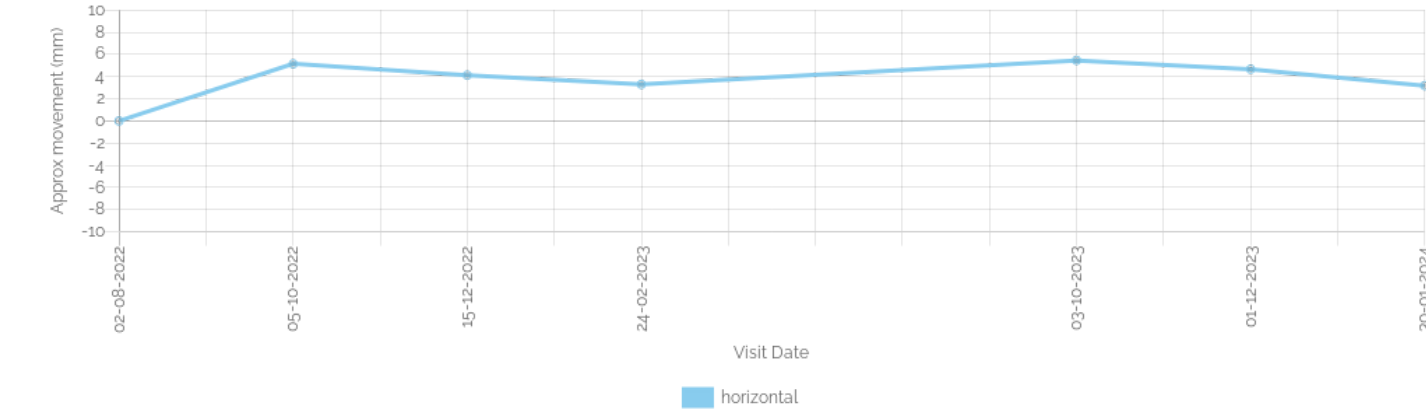

Landing right wall - Photo




Crack Monitoring

Bedroom

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	63.27	672	66.55	65.83	6713	66.69	65.83	
Taken by	N/A	N/A	N/A	N/A	N/A	N/A	KP	
Callipers	001	001	002	004	101	004	101	

Bedroom - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	02/08/22	05/10/22	15/12/22	24/02/23	03/10/23	01/12/23	30/01/24	
H	0	393	328	256	386	342	256	

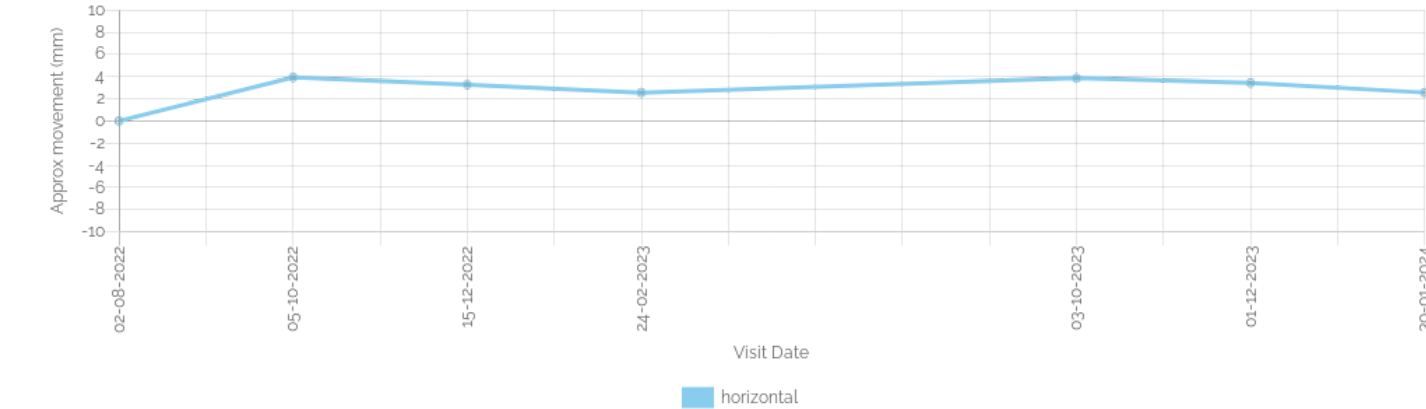

Bedroom - Photo

