

Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: www.apecuk.org/data

Site Air Test Certificate Ref:	ST/26/9/30/CBR1	Date of Issue:	30/09/2026	Page 1 of 6
--------------------------------	-----------------	----------------	------------	-------------

Note: Inspection undertaken in accordance with APEC in-house Methods QCRF2, OH1 and OH2, based on the HSE publication HSG 248 'The Analysts Guide'

Site:	Client:	Contractor:
Bishops Court Floors 3+5 Huddersfield HD4 7PL	One Group Solutions Ltd Newtown Road Marlow Buckinghamshire SL7 1LQ	One Group Solutions Newtown Road Marlow Buckinghamshire SL7 1LQ
Contact:	Contact: Abbie Smith	Contact: N/A

Samples taken by (APEC)

Analyst	Chris Butler	Signed by (APEC)		Date	30/09/2026
----------------	--------------	-------------------------	--	-------------	------------

Air Testing


Purpose of Test

Far-Source Sampling	☐	Near-Source sampling	☐	Leak Test	☐	Background Test	☐	Reassurance Test	☒
----------------------------	--------------------------	-----------------------------	--------------------------	------------------	--------------------------	------------------------	--------------------------	-------------------------	-------------------------------------

Site Photograph and Additional Site Information

	Area Assessed:	Floors 3+5	
	Description of reason for test (including the nature and extent of ACMs removed):	Reassurance air monitoring following the removal of textured coating to walls	
	Site Specific Risk Assessment:	Project Information Sheet (if used):	
	RA/26/9/30/CBR1	-	

Sample Area Layout Plan

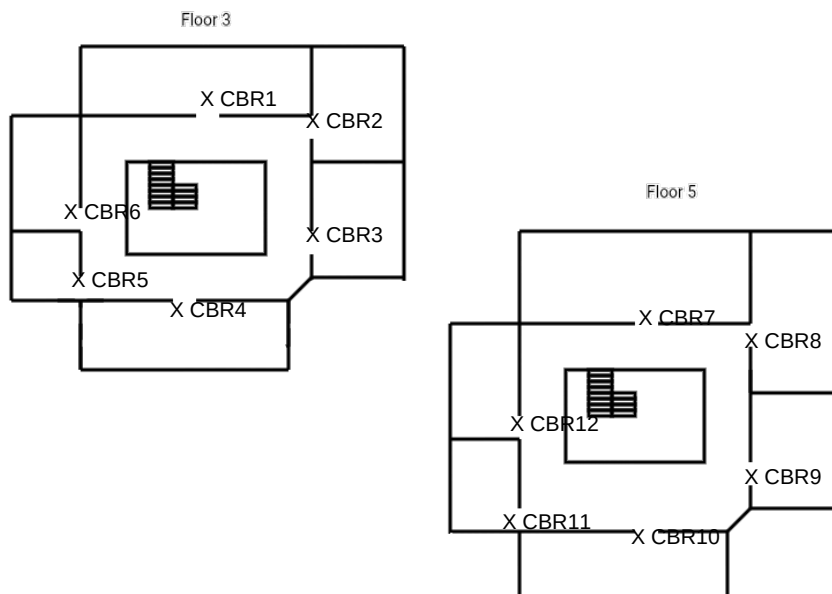

Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: www.apecuk.org/data

Site Air Test Certificate Ref:	ST/26/9/30/CBR1	Date of Issue:	30/09/2026	Page 2 of 6
--------------------------------	-----------------	----------------	------------	-------------

Air Test Summary

Field Blank No.	26/9/A/30/CBR13	Fibres	-	Fields	-	Head No.	9M
Sample Number	Sample Location and Description	Sample Volume (l)	Fibres	Fields	Calculated Concentration (f/ml)	Reported Concentration (f/ml)	Limit of Quantification (f/ml)
26/9/A/30/CBR1	Throughout	504	1	190	0.001	<0.010	0.010
26/9/A/30/CBR2	Throughout	504	3	200	0.002	<0.010	0.010
26/9/A/30/CBR3	Throughout	504	0½	190	0	<0.010	0.010
26/9/A/30/CBR4	Throughout	504	0	190	0	<0.010	0.010
26/9/A/30/CBR5	Throughout	504	2	190	0.001	<0.010	0.010
26/9/A/30/CBR6	Throughout	504	1½	200	0.001	<0.010	0.010
26/9/A/30/CBR7	Throughout	0	0	0	0		0
26/9/A/30/CBR8	Throughout	504	2	190	0.001	<0.010	0.010
26/9/A/30/CBR9	Throughout	504	1	190	0.001	<0.010	0.010
26/9/A/30/CBR10	Throughout	504	1½	190	0.001	<0.010	0.010
26/9/A/30/CBR11	Throughout	504	0½	190	0	<0.010	0.010
26/9/A/30/CBR12	Throughout	504	2	190	0.001	<0.010	0.010
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-

The calculated result is derived from the formula published in HSG 248, The Analysts Guide; $C = 1000 N D^2 / V n d^2$, where:
N = Number of fibres counted; **D** = Diameter of exposed filter area; **V** = Collected volume of sample; **n** = number of fields counted;
d = measured diameter of Walton Beckett graticule

Analysts' Comments (Opinions expressed are outside of the scope of our UKAS accreditation)

Sample 7 unable to read due to too much dust on slide

Findings of Testing and Analysis

The measured respirable airborne fibre concentrations are below the limit of quantification and no remedial measures are considered necessary



One or more of the measured respirable airborne fibre concentrations are elevated and remedial measures have been advised to the client or contractor representative


Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: www.apecuk.org/data


Site Air Test Certificate Ref:	ST/26/9/30/CBR1	Date of Issue:	30/09/2026	Page 3 of 6
--------------------------------	-----------------	----------------	------------	-------------

Photographs

Photograph 1



Photograph 2



Photograph 3



Photograph 4




Sampling pump (sample ref: 26/9/A/30/CBR1)



Sampling pump (sample ref: 26/9/A/30/CBR2)



Sampling pump (sample ref: 26/9/A/30/CBR3)

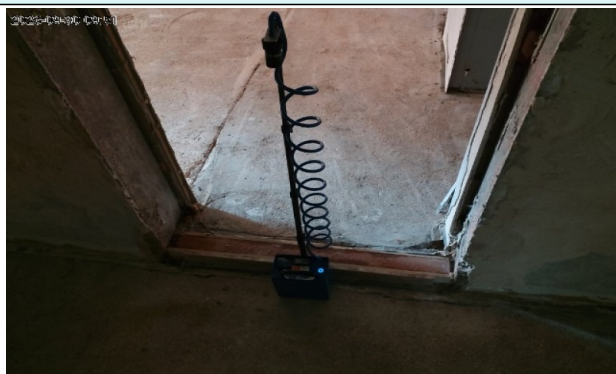

Sampling pump (sample ref: 26/9/A/30/CBR4)



Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: www.apecuk.org/data

Site Air Test Certificate Ref:	ST/26/9/30/GBR1	Date of Issue:	30/09/2026	Page 4 of 6
--------------------------------	-----------------	----------------	------------	-------------

Photographs


Sampling pump (sample ref: 26/9/A/30/GBR5)




Sampling pump (sample ref: 26/9/A/30/GBR6)



Sampling pump (sample ref: 26/9/A/30/GBR7)

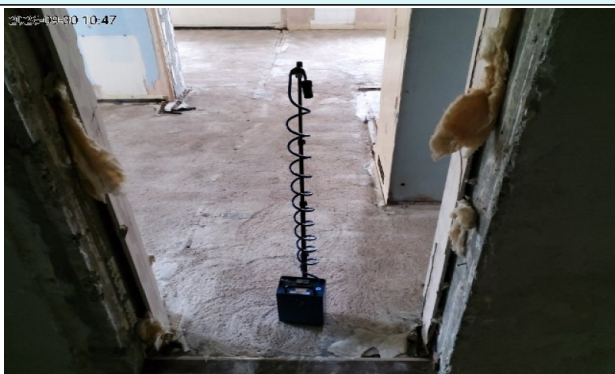

Sampling pump (sample ref: 26/9/A/30/GBR8)

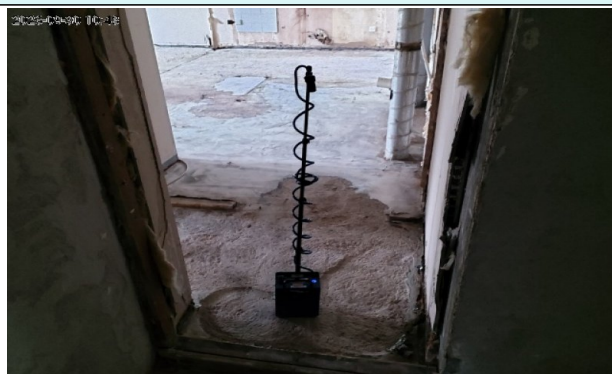

Sampling pump (sample ref: 26/9/A/30/GBR9)



Sampling pump (sample ref: 26/9/A/30/GBR10)



Sampling pump (sample ref: 26/9/A/30/GBR11)



Sampling pump (sample ref: 26/9/A/30/GBR12)



Office 5, Haywood House, Hydra Business Park, Nether Lane, Sheffield, S35 9ZX. Tel: 01142 459371

Access this document online via your asbestos management portal: www.apecuk.org/data

Site Air Test Certificate Ref:	ST/26/9/30/GBR1	Date of Issue:	30/09/2026	Page 6 of 6
--------------------------------	-----------------	----------------	------------	-------------

Note: Inspection undertaken in accordance with APEC in-house Methods QCRF2, OH1 and OH2, based on the HSE publication HSG 248 'The Analysts Guide'

Site:	Client:	Contractor:
Bishops Court Floors 3+5 Huddersfield HD4 7PL	One Group Solutions Ltd Newtown Road Marlow Buckinghamshire SL7 1LQ	One Group Solutions Newtown Road Marlow Buckinghamshire SL7 1LQ
Contact:	Contact: Abbie Smith	Contact: N/A

Appendix 1 - Additional Air Test Information

Notes:

- This information supplements the air test results in the Air Test Certificate and is only valid in conjunction with those results.
- Temperature is recorded in **Kelvin (K)**, Pressure is recorded in **mmHg**, Flowrates are recorded in **litres per minute (l/min)**, Sample volume is recorded in **litres**
- Interim flow checks are only carried out where the overall sample period exceeds approximately 1 hour
- All testing and analysis is undertaken with reference to APEC' task specific risk assessments TRA 01 and TRA 02
- Analysis has been undertaken in accordance with methods described in HSG248, The Analysts guide. The reported results are based on a count of all respirable fibres sampled.

APEC Analytical Equipment

Flow Meter	FM52	Barometer	N/A	Thermometer	N/A	Stop Watch	SW17	Effective filter diameter (mm)	22.60
Stage Micrometer No	SM03	Measured Graticule dia.	100	HSE / NPL Test Slide No.	PC32	No. of bands seen	5	Microscope Number	APM19
Samples counted by (APEC Analyst)	Chris Butler		Signed			Date Analysed	30/09/2026	Analysis Location (Site / Lab)	Site
Test Protocol:	4S (Re-assurance)						Checked by:	N/A	

Suitability of Counting Location Location assessed and adequate (if not record details in Analyst Comments) ☒ **Counting Location (describe)** Site Welfare Facilities

Sample Number	Pump No.	Head No.	Temp	Pressure	Start Flow	Start Time	Interim Flow	Interim Time	End Flow	End Time
26/9/A/30/GBR1	AHFSY16	9A	N/A	N/A	8.4	09:12	-	--:--	8.4	10:12
26/9/A/30/GBR2	AHFSY17	9B	N/A	N/A	8.4	09:13	-	--:--	8.4	10:13
26/9/A/30/GBR3	AHFSY18	9C	N/A	N/A	8.4	09:14	-	--:--	8.4	10:14
26/9/A/30/GBR4	AHFSY19	9D	N/A	N/A	8.4	09:15	-	--:--	8.4	10:15
26/9/A/30/GBR5	AHFSY20	9E	N/A	N/A	8.4	09:16	-	--:--	8.4	10:16
26/9/A/30/GBR6	AHFSY21	9F	N/A	N/A	8.4	09:17	-	--:--	8.4	10:17
26/9/A/30/GBR7	AHFSY16	9G	N/A	N/A	8.4	10:24	-	--:--	8.4	11:24
26/9/A/30/GBR8	AHFSY17	9H	N/A	N/A	8.4	10:25	-	--:--	8.4	11:25
26/9/A/30/GBR9	AHFSY18	9I	N/A	N/A	8.4	10:26	-	--:--	8.4	11:26
26/9/A/30/GBR10	AHFSY19	9J	N/A	N/A	8.4	10:27	-	--:--	8.4	11:27
26/9/A/30/GBR11	AHFSY20	9J	N/A	N/A	8.4	10:28	-	--:--	8.4	11:28
26/9/A/30/GBR12	AHFST21	9K	N/A	N/A	8.4	10:29	-	--:--	8.4	11:29

Analysts in Training

To be signed off by the lead analyst where the analyst carrying out the inspection and testing is working under supervision as part of training.

Trainer / Lead		Signed by (APEC)		Date:	
Trainee		Signed by (APEC)		Date:	