

7 Apollo Court, Monkton Business Park South, Tyne and Wear, NE31 2ES. Tel: 0191 4385884 Fax: 0191 4386375

Access this document online via your asbestos management portal: www.apecuk.org/data

Site Air Test Certificate Ref:	ST/26/6/26/MH1	Date of Issue:	26/06/2026	Page 1 of 5
--------------------------------	----------------	----------------	------------	-------------

Note: Inspection undertaken in accordance with APEC in-house Methods QCRF2, OH1 and OH2, based on the HSE publication HSG 248 'The Analysts Guide'

Site:	Client:	Contractor:
Holme Park Court Berry Brow Huddersfield Yorkshire HD4 7NH	One Group Solutions Ltd Newtown Road Marlow Buckinghamshire SL7 1LQ	One Group Solutions Ltd Newtown Road Marlow Buckinghamshire SL7 1LQ
Contact: Abbie Smith	Contact: Abbie Smith	Contact: N/A

Samples taken by (APEC)

Analyst	Matt Hutchinson	Signed by (APEC)		Date	26/06/2026
----------------	-----------------	-------------------------	--	-------------	------------

Air Testing

Purpose of Test

Far-Source Sampling	Near-Source sampling	Leak Test	Background Test	Reassurance Test	X
---------------------	----------------------	-----------	-----------------	------------------	---

Site Photograph and Additional Site Information



Area Assessed:	Fourteenth Floor of Block of Flats
Description of reason for test (including the nature and extent of ACMs removed):	Reassurance Air Test following removal of Bitumen Adhesive to Floor and Textured Coating from Ceilings (Concrete) and Textured Coating to Concrete Walls and Ceiling to Corridors
Site Specific Risk Assessment:	Project Information Sheet (if used):
RA/26/6/26/MH1	-

Sample Area Layout Plan



Site Air Test Certificate Ref:	ST/26/6/26/MH1	Date of Issue:	26/06/2026	Page 3 of 5
--------------------------------	----------------	----------------	------------	-------------

Photographs

Floor Entrance



Ceiling



Ceiling




Floor



Sampling pump (sample ref: 26/6/A/26/MH1)



Sampling pump (sample ref: 26/6/A/26/MH2)

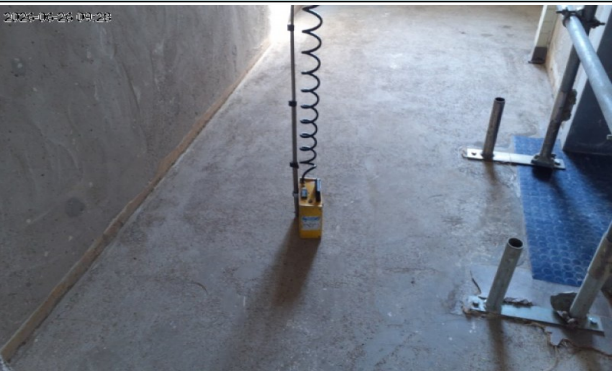

Sampling pump (sample ref: 26/6/A/26/MH3)



Sampling pump (sample ref: 26/6/A/26/MH4)



Site Air Test Certificate Ref:	ST/26/6/26/MH1	Date of Issue:	26/06/2026	Page 4 of 5
--------------------------------	----------------	----------------	------------	-------------

Photographs

Sampling pump (sample ref: 26/6/A/26/MH5)



Sampling pump (sample ref: 26/6/A/26/MH6)



7 Apollo Court, Monkton Business Park South, Tyne and Wear, NE31 2ES. Tel: 0191 4385884 Fax: 0191 4386375

Access this document online via your asbestos management portal: www.apecuk.org/data

Site Air Test Certificate Ref:	ST/26/6/26/MH1	Date of Issue:	26/06/2026	Page 5 of 5
--------------------------------	----------------	----------------	------------	-------------

Note: Inspection undertaken in accordance with APEC in-house Methods QCRF2, OH1 and OH2, based on the HSE publication HSG 248 'The Analysts Guide'


Site:	Client:	Contractor:
Holme Park Court Berry Brow Huddersfield Yorkshire HD4 7NH	One Group Solutions Ltd Newtown Road Marlow Buckinghamshire SL7 1LQ	One Group Solutions Ltd Newtown Road Marlow Buckinghamshire SL7 1LQ
Contact: Abbie Smith	Contact: Abbie Smith	Contact: N/A

Appendix 1 - Additional Air Test Information

Notes:

- This information supplements the air test results in the Air Test Certificate and is only valid in conjunction with those results.
- Temperature is recorded in **Kelvin (K)**, Pressure is recorded in **mmHg**, Flowrates are recorded in **litres per minute (l/min)**, Sample volume is recorded in **litres**
- Interim flow checks are only carried out where the overall sample period exceeds approximately 1 hour
- All testing and analysis is undertaken with reference to APEC' task specific risk assessments TRA 01 and TRA 02
- Analysis has been undertaken in accordance with methods described in HSG248, The Analysts guide. The reported results are based on a count of all respirable fibres sampled.

APEC Analytical Equipment

Flow Meter	FM42	Barometer	N/A	Thermometer	N/A	Stop Watch	SW23	Effective filter diameter (mm)	22.60
Stage Micrometer No	SM06	Measured Graticule dia.	100	HSE / NPL Test Slide No.	PC33	No. of bands seen	5	Microscope Number	APM45
Samples counted by (APEC Analyst)	Matt Hutchinson		Signed			Date Analysed	26/06/2026	Analysis Location (Site / Lab)	Site
Test Protocol:	4S (Re-assurance)						Checked by:	N/A	

Suitability of Counting Location	Location assessed and adequate (if not record details in Analyst Comments)	☒	Counting Location (describe)	Site Welfare Cabin
---	---	-------------------------------------	-------------------------------------	--------------------

Sample Number	Pump No.	Head No.	Temp	Pressure	Start Flow	Start Time	Interim Flow	Interim Time	End Flow	End Time
26/6/A/26/MH1	HFNE 10	6A	N/A	N/A	8.5	09:22	-	--:--	8.5	10:23
26/6/A/26/MH2	HFNE 21	6B	N/A	N/A	8.5	09:23	-	--:--	8.5	10:24
26/6/A/26/MH3	HFNE 22	6C	N/A	N/A	8.5	09:24	-	--:--	8.5	10:25
26/6/A/26/MH4	HFNE 23	6D	N/A	N/A	8.5	09:25	-	--:--	8.5	10:26
26/6/A/26/MH5	HFNE 25	6E	N/A	N/A	8.5	09:26	-	--:--	8.5	10:27
26/6/A/26/MH6	HFNE 26	6F	N/A	N/A	8.5	09:27	-	--:--	8.5	10:28
-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-
-	-	-	-	-	-	-	-	-	-	-

Analysts in Training

To be signed off by the lead analyst where the analyst carrying out the inspection and testing is working under supervision as part of training.

Trainer / Lead		Signed by (APEC)		Date:	
Trainee		Signed by (APEC)		Date:	